

Heathkit

IP 20

132

Heathkit

IP 20

85
LAN

PRICE \$2.00

HEATHKIT® ASSEMBLY MANUAL



TRANSISTORIZED REGULATED
POWER SUPPLY


MODEL IP-20

RESISTOR AND CAPACITOR COLOR CODES

RESISTORS

colored bands around the body of a color coded resistor represent its value in ohms. These colored bands are grouped around one end of the resistor body. Starting with this end of the resistor, the first band represents the first digit of resistance value; the second band represents the second digit; the third band represents the number by which the first digits are multiplied. A fourth band of gold or silver represents a tolerance of $\pm 5\%$ or $\pm 10\%$ respectively. The absence of a fourth band indicates a tolerance of $\pm 20\%$.

COLOR	1ST DIGIT	2ND DIGIT	MULTIPLIER
BLACK	0	0	1
BROWN	1	1	10
RED	2	2	100
ORANGE	3	3	1,000
YELLOW	4	4	10,000
GREEN	5	5	100,000
BLUE	6	6	1,000,000
VIOLET	7	7	10,000,000
GRAY	8	8	100,000,000
WHITE	9	9	1,000,000,000
GOLD	-	-	.1
SILVER	-	-	.01

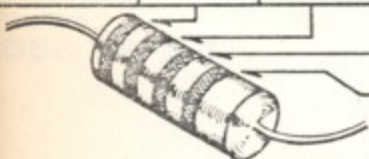


TOLERANCE
GOLD $\pm 5\%$
SILVER $\pm 10\%$
NO BAND $\pm 20\%$

The physical size of a composition resistor is related to its wattage rating. Size increases progressively as the wattage rating is increased. The diameters of 1/2 watt, 1 watt and 2 watt resistors are approximately 1/8", 1/4" and 5/16", respectively.

The color code chart and examples which follow provide the information required to identify color coded resistors.

EXAMPLES

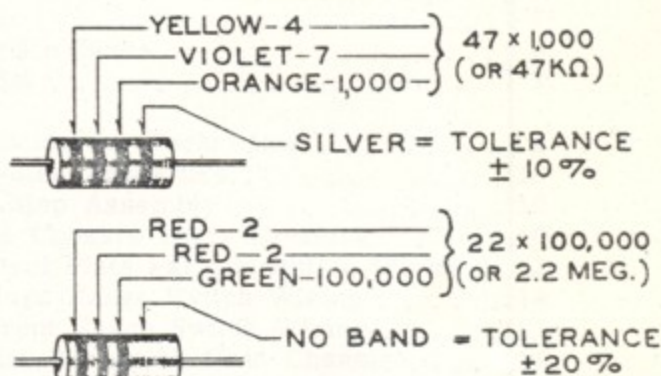

CAPACITORS


Generally, only mica and tubular ceramic capacitors, used in modern equipment, are color coded. The color codes differ somewhat among capacitor manufacturers, however the codes

shown below apply to practically all of the mica and tubular ceramic capacitors that are in common use. These codes comply with EIA (Electronic Industries Association) Standards.


MICA

COLOR	1ST DIGIT	2ND DIGIT	MULTIPLIER	TOLER %
BLACK	0	0	1	± 20
BROWN	1	1	10	± 2
RED	2	2	100	± 3
ORANGE	3	3	1,000	± 5
YELLOW	4	4	10,000	± 5
GREEN	5	5	—	± 5
BLUE	6	6	—	± 5
VIOLET	7	7	—	± 5
GRAY	8	8	—	± 5
WHITE	9	9	—	± 5
GOLD	-	-	.1	± 10
SILVER	-	-	.01	± 10

EXAMPLE

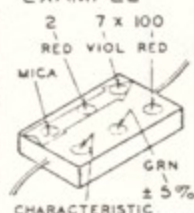

2700 puf $\pm 5\%$
OR .0027 ufd

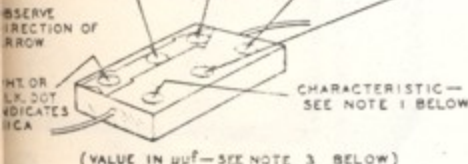


TUBULAR CERAMIC

Place the group of rings or dots to the left and read from left to right.

COLOR	1ST DIGIT	2ND DIGIT	MULTIPLIER	TOLER %
BLACK	0	0	1	± 20
BROWN	1	1	10	± 20
RED	2	2	100	± 20
ORANGE	3	3	1,000	± 20
YELLOW	4	4	10,000	± 20
GREEN	5	5	—	± 20
BLUE	6	6	—	± 20
VIOLET	7	7	—	± 20
GRAY	8	8	—	± 20
WHITE	9	9	—	± 20

EXAMPLE

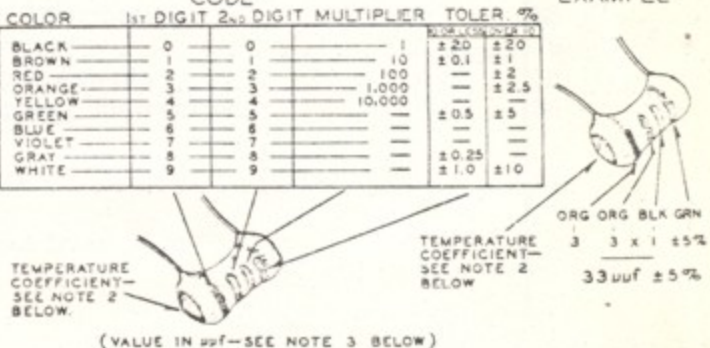

NOTES:

The characteristic of a mica capacitor is the temperature coefficient, drift capacitance and insulation resistance. This information is not usually needed to identify a capacitor. If desired, it can be obtained by referring to EIA Standard, RS-153 (a Standard of Electronic Industries Association.)

The temperature coefficient of a capacitor is the predicted change in capacitance with temperature change and is

expressed in parts per million per degree centigrade. Refer to EIA Standard, RS-198 (a Standard of Electronic Industries Association.)

3. The farad is the basic unit of capacitance, however capacitor values are generally expressed in terms of puf (microfarad, .000001 farad) and μuf (micro-micro-farad, .000001 μfd); therefore, 1,000 μuf = .001 μfd, 1,000,000 μuf = 1 μfd.

USING A PLASTIC NUT STARTER

 
A plastic nut starter offers a convenient method of starting the most used sizes: 3/16" and 1/4" (40 and 6-32). When the correct end is pushed over a nut, the pliable tool conforms to the shape of the nut and the nut is gently held while it is being picked up and started on the screw. The tool should only be used to start the nut.

6-32




3-48

assembly
and
operation
the



TRANSISTORIZED REGULATED POWER SUPPLY

MODEL IP-20

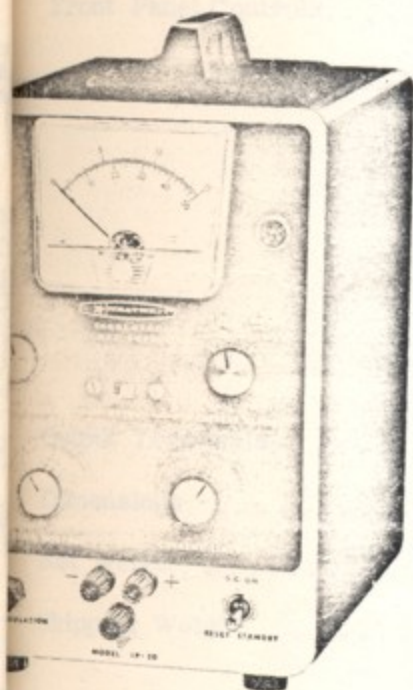


HEATH COMPANY,
FARMINGTON HARBOR,
CONNECTICUT

TABLE OF CONTENTS

Specifications	2
Introduction	3
Circuit Description	3
Schematic	5*
Construction Notes	6
Parts List	7
Proper Soldering Techniques	9
Step-By-Step Procedure	10
Step-By-Step Assembly	10
Main Chassis Parts Mounting	10
Control Plate Parts Mounting-Wiring	12
Voltage Range Switch Wiring	14
Current Range Switch Wiring	17
Initial Wiring on Main Chassis	18
Final Wiring on Main Chassis Top	26
Final Wiring Checkout	28
Initial Test And Adjustment	29
Final Assembly	30
Final Adjustment	31
Operation	32
In Case Of Difficulty	34
Troubleshooting Chart	34
Service Information	35
Service	35
Replacements	36
Shipping Instructions	36
Warranty	37

*Fold-out from page.

 All prices are subject to change without notice. The Heath Company reserves the right to discontinue instruments and to change specifications at any time without incurring any obligation to incorporate new features in instruments previously sold.



SPECIFICATIONS

Power Requirements.	105-125 volts, 50/60 cps, 135 watts at full load (50 volts at 1.5 amperes).
Output.	0.5 to 50 volts DC at 1.5 amperes, maximum.
Load Regulation.	±15 millivolts. Can be adjusted for no change.
Line Regulation (105-125 V AC).	Less than .005% change.
Ripple And Noise.	150 microvolts maximum.
Transient Response.	Less than 25 microseconds.
Output Impedance.	Less than .1 Ω DC to 10 kc. Less than .5 Ω 10 kc and up.
Overload Protection.	Adjustable current limiter and relay.
Meter.	3-1/2", 1 milliampere, 50 Ω. Current Ranges: 50 ma, 150 ma. 500 ma, 1.5 ampere. Voltage Ranges: 5 V, 15 V, 50 V.
Front Panel Controls.	VOLTAGE RANGE switch-AC ON/OFF, 10 steps of 5 volt increments. FINE VOLTAGE control - Varies output 6 volts. CURRENT RANGE switch - Selects desired current range. CURRENT LIMIT control - Adjustable from 30 to 110% of current range. METER Slide Switch - Selects voltmeter or ammeter. DC REGULATION Control - Adjusts DC output resistance. RESET STANDBY Toggle Switch - Disconnects positive output terminal from load.
Output Terminals.	Positive (+), Negative (-), Chassis ground ($\frac{1}{2}$).
Dimensions.	9-1/2" high x 6-1/2" wide x 11" deep.
Net Weight.	11 lbs.
Shipping Weight.	14 lbs.

INTRODUCTION

Heathkit Model IP-20 Transistorized Regulated Power Supply will be very valuable when a well-regulated variable power source is needed. With the rapid increase in the use of transistor circuitry in audio amplifiers, radios, television, a regulated voltage supply is a must for a well equipped repair shop or engineering laboratory.

The Power Supply features an automatic current limiter for protection of the load as well as protection circuitry, and an overload relay for protection in case of a direct short or heavy load. Other features of the Power Supply include a CURRENT RANGE switch which provides current ranges from 50 ma to 1.5 amperes, a

VOLTAGE RANGE switch with ranges from 5 to 50 volts and a DC REGULATION control for the fine setting of the feedback circuit. The DC REGULATION control makes it possible to obtain ideal DC regulation at any voltage setting from 1 to 50 volts.

The use of transistors and a tapped transformer makes the relatively small cabinet size of the Power Supply possible, as the large quantity of heat usually found in such a regulated power supply is eliminated. The attractive styling of this Power Supply plus the excellent regulation makes it an ideal instrument for both the laboratory and the modern repair shop.

CIRCUIT DESCRIPTION

Refer to the Block Diagram and to the Schematic Diagram (fold-out from Page 5) while reading this Circuit Description.

The power supply is divided into three sections: the main power supply, with all its regulator circuits; the limiter bias supply which supplies current to limiter transistor X1; and the reference voltage supply, which supplies the regulated reference voltage to error detector transistor X2.

MAIN POWER SUPPLY

Two different AC voltages are coupled from the primary winding of the power transformer to sec-

tion VR-4 of the Voltage Range switch. One of these voltages is applied through the switch to the bridge rectifier circuit.

The rectified voltage from the bridge circuit is applied to filter capacitor C2 and to bleeder resistor R3. The unregulated current from the rectifier and filter is then coupled through the current limiter circuits to the voltage regulator circuits. See Figure 1.

Basic Voltage Regulator Feedback Circuit

Transistors X4 and X5, which are connected in parallel, act as a series regulator, much the same as a vacuum tube series regulator stage.

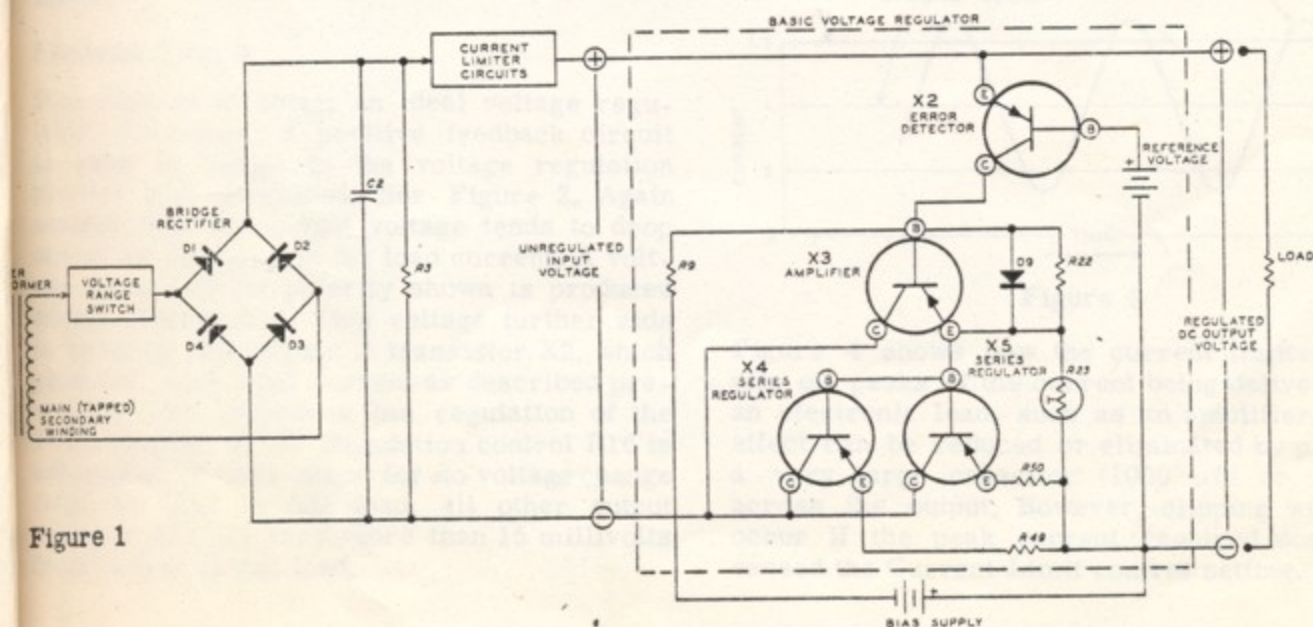


Figure 1

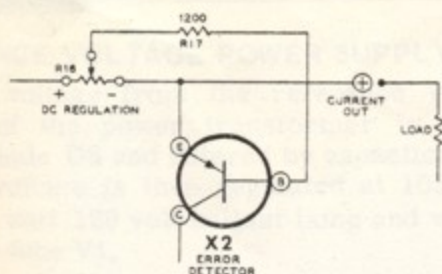
 


Figure 2

If a load is connected to the output terminals, the regulated DC voltage tends to decrease. As this output voltage decreases, the voltage at the emitter of transistor X2 decreases also, but the voltage at the base of transistor X2 stays the same, since the reference voltage remains constant. This decreased voltage between the emitter and base causes a decrease in the collector current in transistor X2.

The current decrease in transistor X2 causes the base current of transistor X3 to increase proportionally (the current through resistor R9 from the bias supply is constant). As the emitter current of transistor X3 increases because of increased base current, a resultant current increase also occurs in the bases of series regulator transistors X4 and X5. This increases the load current and restores the output voltage to its original value. This entire process occurs in a matter of microseconds.

If the output voltage increases due to decreased loading, the above procedure reverses and the output voltage decreases to the original value. Diode D9 prevents back biasing on transistor X3 when the output of the Power Supply is unloaded.

Feedback Circuit

It is difficult to obtain an ideal voltage regulator. Therefore, a positive feedback circuit is used to assist in the voltage regulation process just described. See Figure 2. Again assume that the output voltage tends to drop due to an increase in the load current. A voltage change of the polarity shown is produced across control R16. This voltage further aids in reducing the current in transistor X2, which produces more load current as described previously. This improves the regulation of the Power Supply. If DC Regulation control R16 is adjusted at 15 volts output for no voltage change from no load to full load, all other output voltages will not vary more than 15 millivolts from no load to full load.

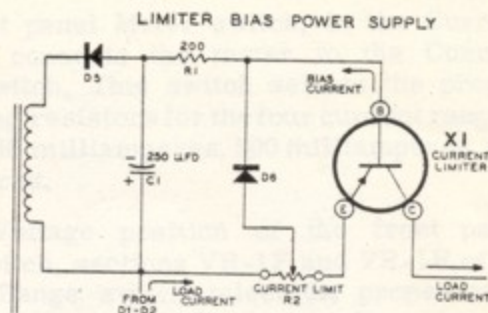


Figure 3

CURRENT LIMITER CIRCUIT

Current limiter transistor X1 normally operates in a saturated state because of the base bias current from the limiter bias power supply. See Figure 3. When the Power Supply load current which flows through Current Limit control R2, increases, an increased voltage is coupled from the arm of control R2 to diode D6. This causes diode D6 to start conducting. As soon as diode D6 begins to conduct, the emitter to base voltage of transistor X1 decreases and limits the current at the value being delivered. The setting of Current Limit control R2 determines the point at which diode D6 will begin to conduct.

The current limit resistors, R4 through R8, are switched by Current Range switch CR-2. Therefore, the working range of the Current Limit control R2 is changed with the Current Range switch CR-2 to provide limiting on all current ranges.

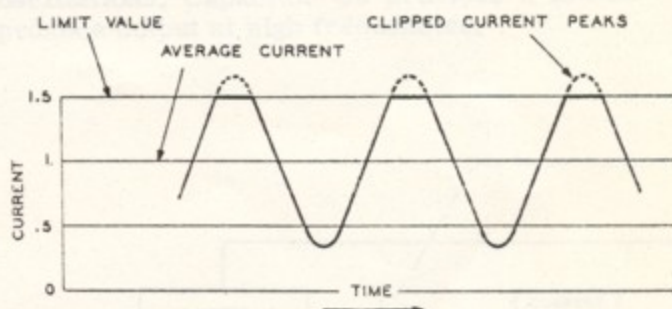


Figure 4

Figure 4 shows how the current limiter will clip off peaks of the current being delivered to an electronic load, such as an amplifier. This effect can be reduced or eliminated by placing a very large capacitor (1000 μ fd or more) across the output. However, clipping will not occur if the peak current required does not exceed the Current Limit control setting.

REFERENCE VOLTAGE POWER SUPPLY

The AC voltage from the reference voltage winding of the power transformer is rectified by diode D8 and filtered by capacitor C10. The DC voltage is then regulated at 105 volts by the 6 watt 120 volt ballast lamp and voltage regulator tube V1.

The DC voltage from tube V1 is then coupled through resistor R48 to a filter circuit consisting of capacitors C9 and C8, and Zener current Adjust control R47. The output voltage from this filter circuit is applied to zener diode Z1 and resistor R45, which is in series with the diode.

The regulated voltage from diode Z1 is then applied to Voltage Calibrate control R43. Control R43 is adjusted so exactly 50 volts is applied across wafer VR-3R of the Voltage Range switch, Fine Voltage control R42, and wafer VR-2F of the Voltage Range switch to B-. These two switch sections select any 6 volt portion of the 50 volts and apply it across the Fine Voltage control R42. The desired reference voltage is then coupled from the arm of this control to the base of error detector transistor Q2, where the output voltage of the Power Supply is regulated to essentially the same voltage level.

The zener current can be measured by placing the Meter switch on the control plate in the Zener Current position. The Zener Current adjust control is then set to produce 5 ma of zener current.

METER CIRCUIT

The front panel meter can be used to indicate output voltage, output current, or zener diode current. The control plate Meter switch has two positions. In the Normal position, the meter is connected to the front panel Meter switch. In the Zener Current position, the meter with resistor R44 in series with it, is connected in parallel with resistor R45 to measure the current of zener diode Z1.

The front panel Meter switch, in the Current position, connects the meter to the Current Range switch. This switch selects the proper calibrating resistors for the four current ranges: 50 ma, 150 milliamperes, 500 milliamperes, and 1.5 amperes.

In the Voltage position of the front panel Meter switch, sections VR-1F and VR-1R of the Voltage Range switch select the proper calibrating resistors for the three voltage ranges: 5 volts, 15 volts, and 50 volts. The proper resistors are then connected in series with the meter between the negative (-) and the positive (+) output terminals.

OTHER CIRCUITS

One side of the relay is connected through diode D7 and the Reset Standby switch to the positive (+) output terminal. The other side of the coil is connected to the reference voltage at the arm of Fine Voltage control R42. If a large overload is applied to the output terminals, the voltage at the positive output terminal is decreased, but the reference voltage at the arm of control R42 remains constant. When there is approximately 7 volts difference between these two voltages, the relay is activated, and the open relay contacts open the B+ line between the bridge rectifier and the current limiter circuits.

Capacitors C4 and C6 reduce the AC output impedance as well as hum and noise. They also provide AC stability to the circuit to prevent oscillations. Capacitor C5 provides a low impedance output at high frequencies.





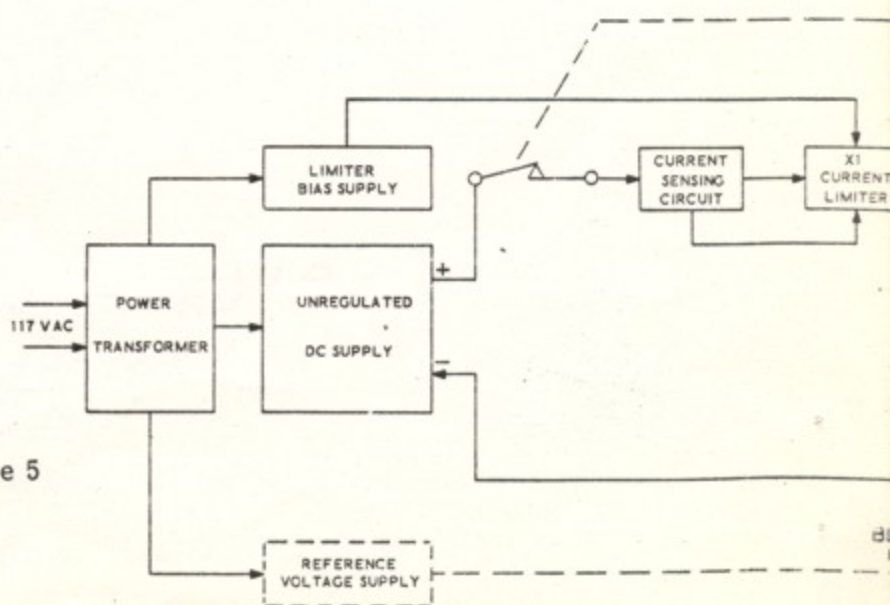


Figure 5

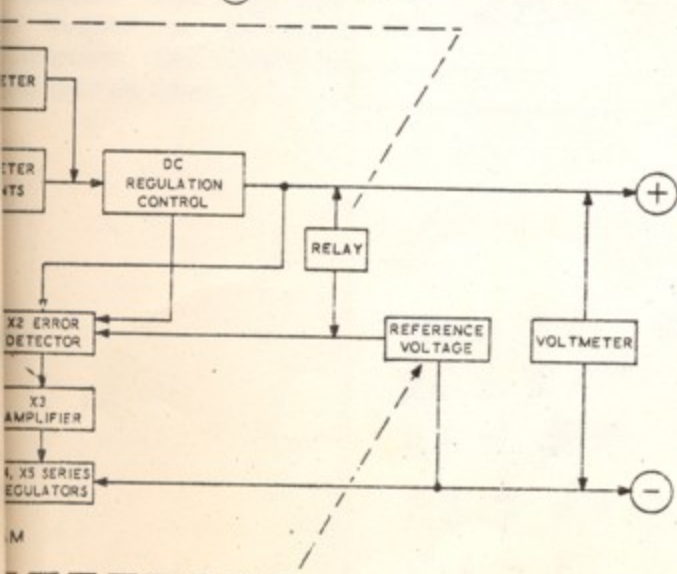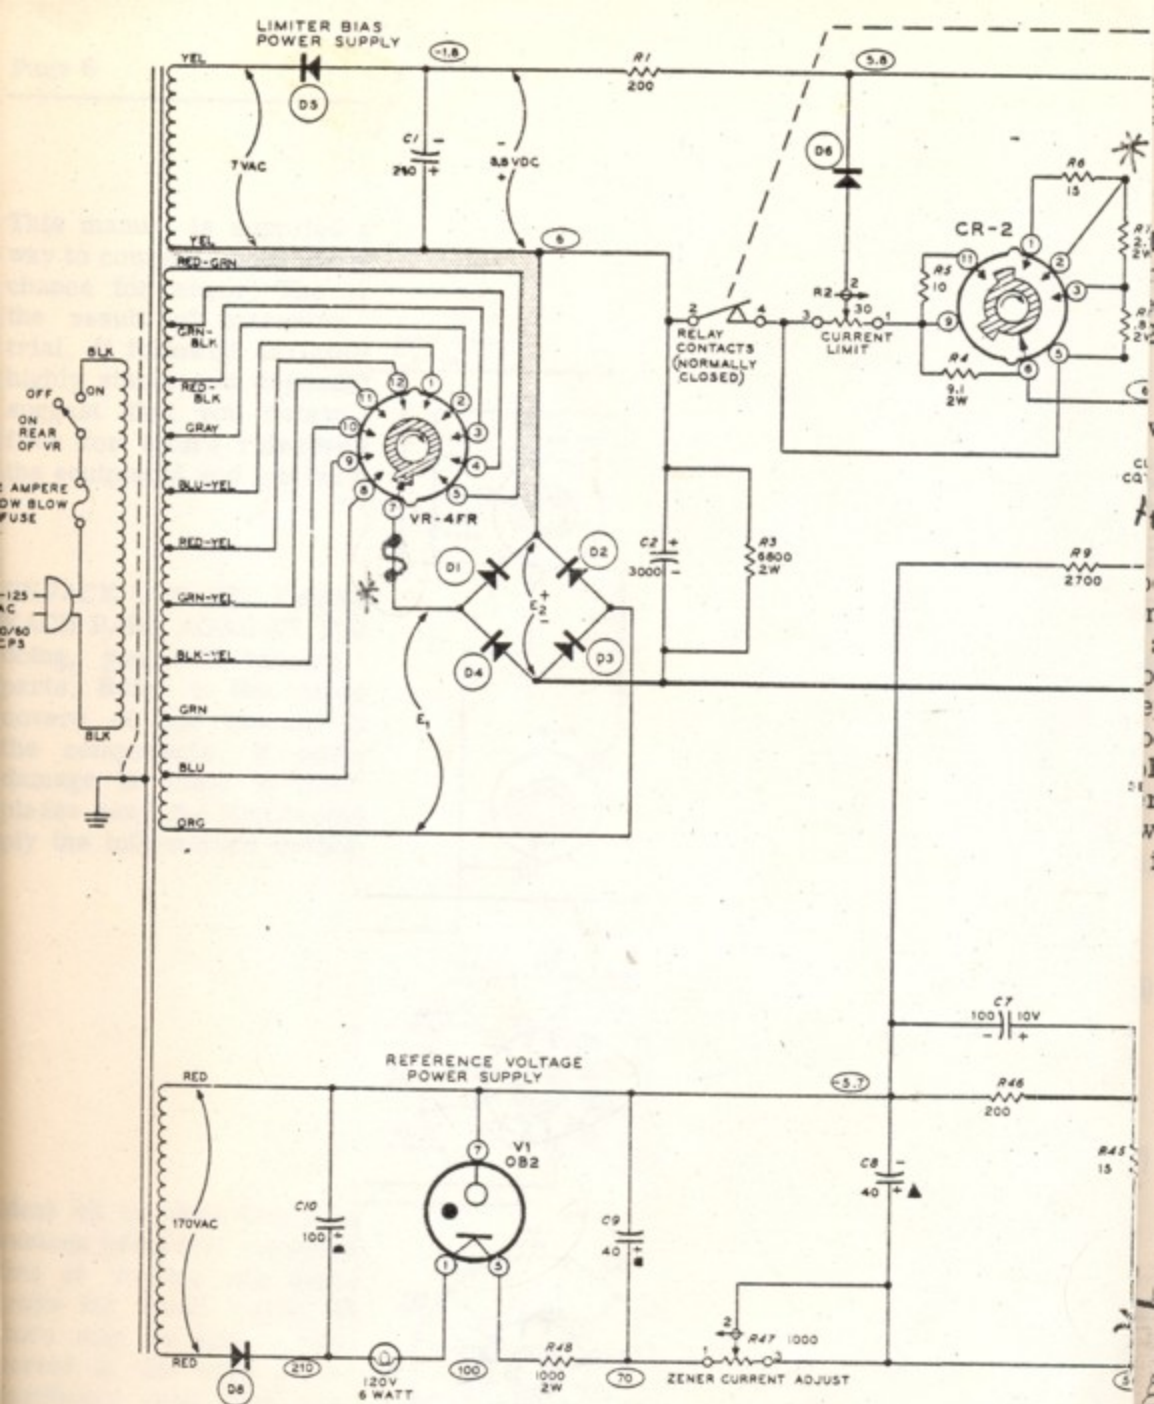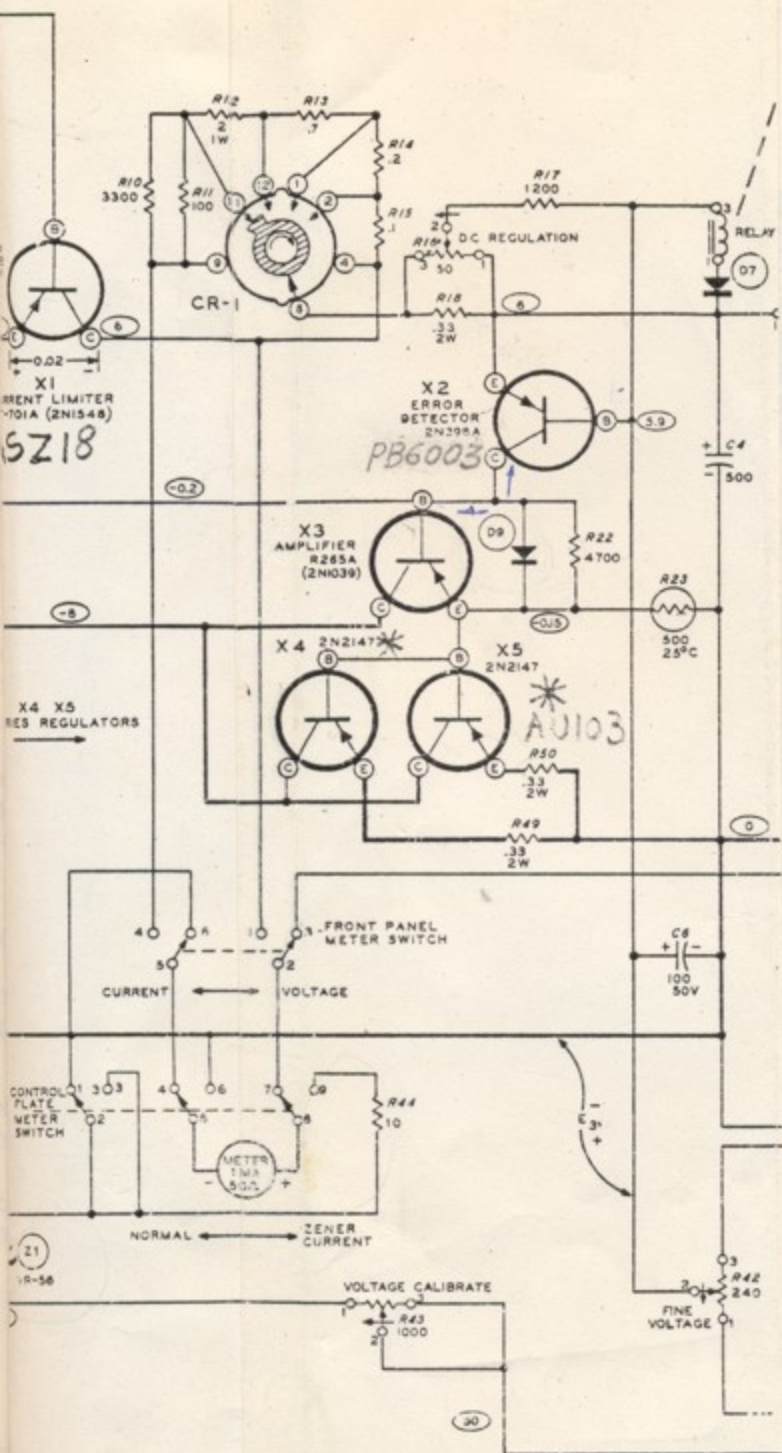

 

NOTES:

1. ALL RESISTORS ARE 1/2 WATT UNLESS MARKED OTHERWISE. RESISTOR VALUES ARE IN OHMS (K = 1000).
2. ALL CAPACITORS ARE IN μ M.
3.  INDICATES A DC VOLTAGE MEASUREMENT FROM POINT INDICATED TO NEGATIVE (-) OUTPUT TERMINAL.
4. ALL VOLTAGES, WHICH ARE DC UNLESS MARKED OTHERWISE, WERE MEASURED WITH NO LOAD ON THE OUTPUT TERMINALS AND WITH 117 VAC, 60 CPS, INPUT.
5. ALL VOLTAGES WERE MEASURED WITH A VTVM, AND MAY VARY $\pm 10\%$.
6. ARROWS ON CONTROLS INDICATE CLOCKWISE ROTATION. CONTROLS SET AS FOLLOWS FOR VOLTAGE MEASUREMENTS:
 - VOLTAGE RANGE - 5
 - CURRENT RANGE - 1.5A
 - FINE VOLTAGE - MAX clockwise
 - CURRENT LIMIT - MAX clockwise
 - TOGGLE SWITCH - Reset-standby
 - METER SWITCH - Voltage
7. DIODES D1 THROUGH D7 - SILICON, 100 V PIV.
DIODE D8 - SILICON, 500 V PIV.
DIODE D9 - GERMANIUM.
8. ROTARY SWITCHES ARE SHOWN IN MAXIMUM COUNTERCLOCKWISE POSITION, AND ARE MARKED AS IN THE FOLLOWING EXAMPLES.

VR MEANS THIS IS PART OF THE VOLTAGE RANGE SWITCH.
THIS NUMBER INDICATES THE SWITCH WAFER, AS COUNTED FROM THE FRONT PANEL.


F = FRONT, R = REAR OF THE WAFER.

CR MEANS THIS IS PART OF THE CURRENT RANGE SWITCH.
THIS NUMBER INDICATES THE SWITCH WAFER, AS COUNTED FROM THE FRONT PANEL.

POSITION OF VR SWITCH	E1 VOLTS AC	E2 VOLTS DC	E3 VOLTS DC
5	10	1.4	5
10	15	2.1	10
15	20	2.8	15
20	25	3.5	20
25	29	4.1	25
30	33	4.7	30
35	38	5.4	35
40	43	6.0	40
45	47	6.6	45
50	53	7.4	50

Set controls as in NOTES except for Voltage Range (VR) switch

SCHEMATIC OF THE HEATHKIT® TRANSISTORIZED REGULATED POWER SUPPLY MODEL IP-20

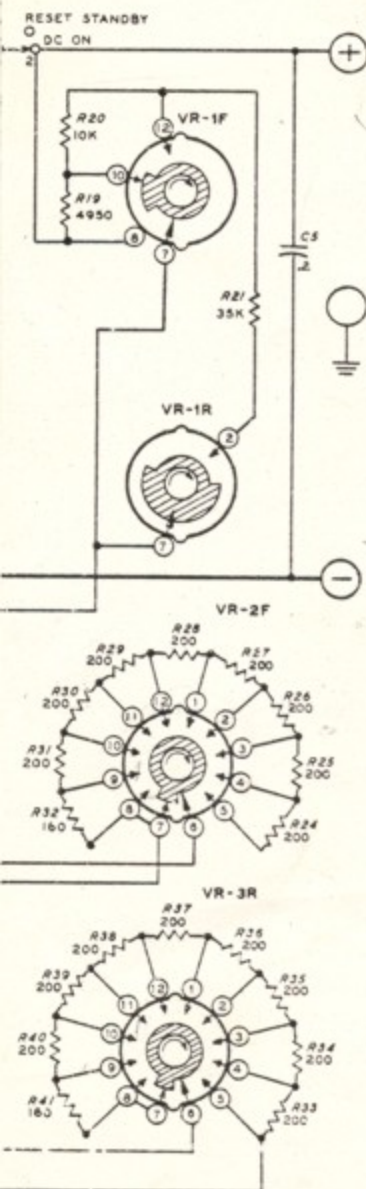

$$X4 \text{ e } X5 = AV 103$$

$$R6 = 27\Omega \text{ } 1/2W$$

$$R7 = 5\Omega \text{ } 1W$$

$$R8 = 11\Omega \text{ } 2W$$

$$R18 = 3 \text{ em paralelo de } 1,2\Omega$$

colocado fusivel de 2A

Feito em
3-2-75

Antonio/Paixão

CONSTRUCTION NOTES

This manual is supplied to assist you in every way to complete your kit with the least possible chance for error. The arrangement shown is the result of extensive experimentation and trial. If followed carefully, the result will be highly stable and dependable performance. We suggest that you retain the manual in your files for future reference, both in the use of the equipment and for its maintenance.


UNPACK THE KIT CAREFULLY AND CHECK EACH PART AGAINST THE PARTS LIST. In so doing, you will become acquainted with the parts. Refer to the information on the inside covers of the manual to help you identify the components. If some shortage or parts damage is found in checking the Parts List, please read the Replacements section and supply the information called for therein.

Resistors generally have a tolerance rating of 10% unless otherwise stated in the Parts List. Tolerances on capacitors are generally even greater. Limits of +100% and -20% are common for electrolytic capacitors.


















We suggest that you do the following before work is started:

1. Lay out all parts so that they are readily available.
2. Provide yourself with good quality tools. Basic tool requirements consist of a screwdriver with a 1/4" blade; a small screwdriver with a 1/8" blade; long-nose pliers; wire cutters, preferably separate diagonal cutters; a penknife or a tool for stripping insulation from wires; a soldering iron (or gun) and rosin core solder. A set of nut drivers and a nut starter, while not necessary, will aid extensively in construction of the kit.

























Most kit builders find it helpful to separate the various parts into convenient categories. Muffin tins or molded egg cartons make convenient trays for small parts. Resistors and capacitors may be placed with their lead ends inserted in the edge of a piece of corrugated cardboard until they are needed. Values can be written on the cardboard next to each component. The illustration shows one method that may be used.

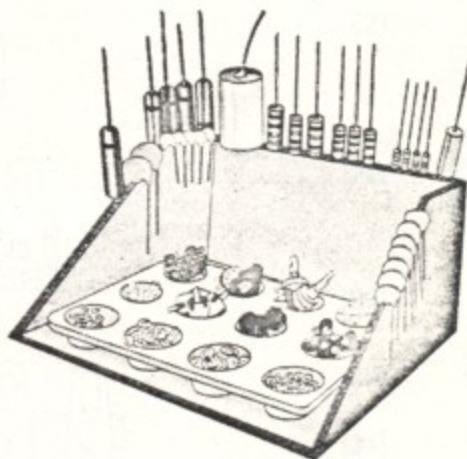

PARTS

      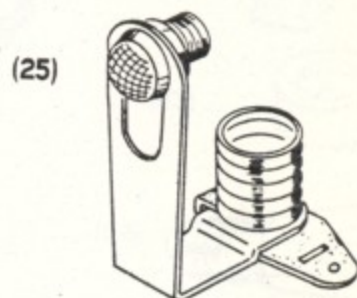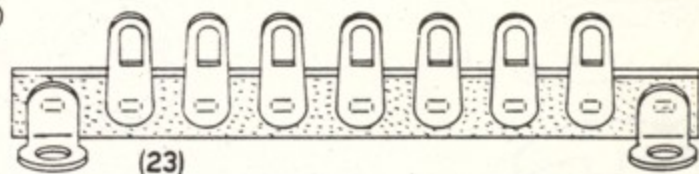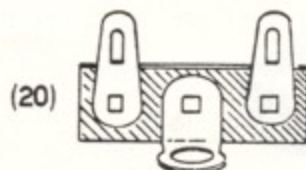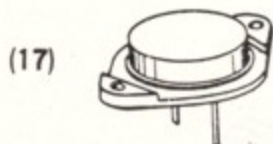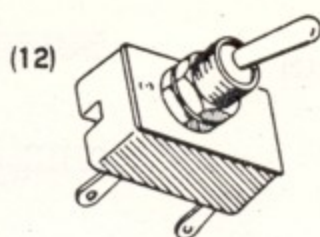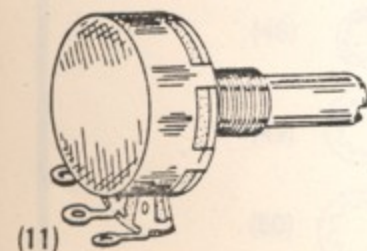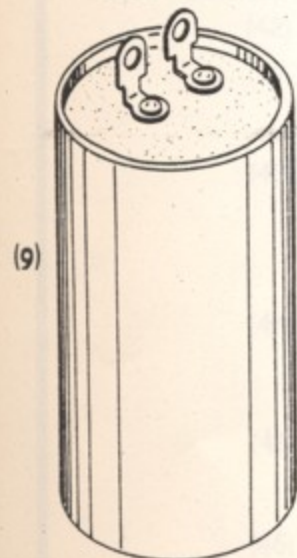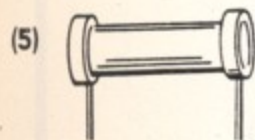   

PICTORIAL

       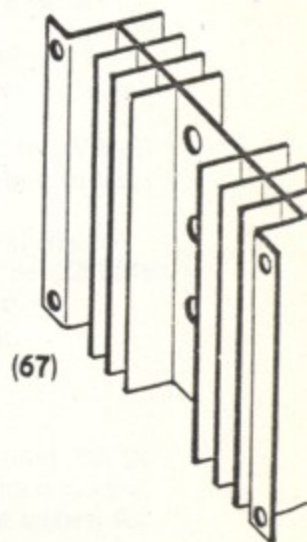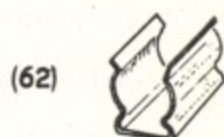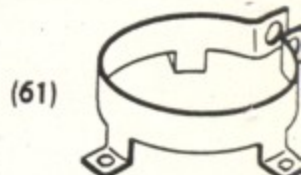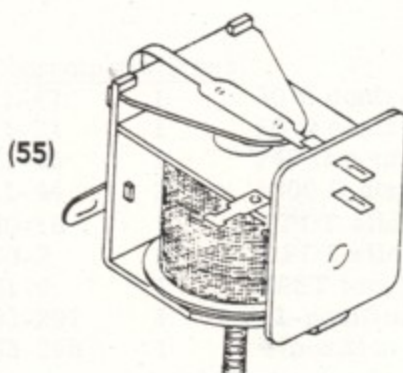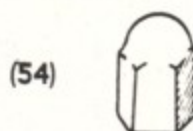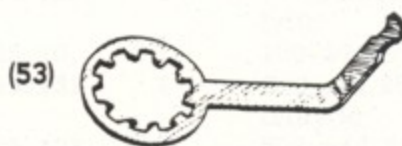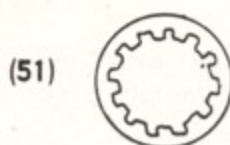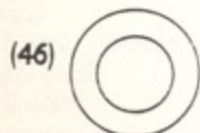         


PARTS LIST

The numbers in parentheses in the Parts List are keyed to the numbers in the Parts Pictorial to aid in parts identification.

PARTS Per Kit	DESCRIPTION	PART No.	PARTS Per Kit	DESCRIPTION
Capacitors				
2	10 Ω 1/2 watt (brown-black-black)	(8) 25-56	1	100 μ fd 10 V tubular electrolytic
2	15 Ω 5% 1/2 watt (brown-green-black-gold)	25-128	1	100 μ fd 50 V tubular electrolytic
2	160 Ω 5% 1/2 watt (brown-blue-brown-gold)	25-70	1	100-40-40 μ fd electrolytic
18	200 Ω 5% 1/2 watt (red-black-brown-gold)	25-131	1	250 μ fd 25 V tubular electrolytic
1	1200 Ω 5% 1/2 watt (brown-red-red-gold)	25-121	1	500 μ fd 50 V tubular electrolytic
1	2700 Ω 1/2 watt (red-violet-red)	(9) 25-122	1	3000 μ fd 75 V tubular electrolytic
1	3300 Ω 5% 1/2 watt (orange-orange-red-gold)	(10) 27-4	1	.2 μ fd mylar
1	4700 Ω 1/2 watt (yellow-violet-red)			
1	1000 Ω 2 watt (brown-black-red)	Controls-Switches		
1	6800 Ω 2 watt (blue-gray-red)	(11) 11-47	1	30 Ω control
		11-21	1	50 Ω control
		11-45	1	240 Ω control
		11-44	2	1000 Ω control
		60-16	1	TPDT slide switch
		60-2	1	DPDT slide switch
		(12) 61-9	1	SPST toggle switch
		63-297	1	11-position rotary switch
		63-298	1	4-position rotary switch
Transformer-Diodes-Transistors-Tube				
		54-123	1	Power transformer
		(13) 56-8	1	Germanium diode
		(14) 56-13	1	56 V zener diode (VR56)
		(15) 57-27*	1	Silicon diode (packed in bag)
		57-29	7	Silicon diode
		(16) 417-20	1	R265A transistor (2N1039)
		(17) 417-42	1	CQT701A transistor (2N1548)
		(18) 417-43	1	2N398A transistor
		417-44	2	2N2147 transistor (matched pair)
		411-46	1	OB2 tube

 *NOTE: The #57-27 silicon diode must not be interchanged with one of the other silicon diodes. Keep this diode in its bag until it is called for in assembly.



PART No.	PARTS Per Kit	DESCRIPTION	PART No.	PARTS Per Kit	DESCRIPTION
<u>Terminal Strips-Sockets-Knobs</u>			<u>Miscellaneous</u>		
431-14	1	2-lug terminal strip	(55) 69-13	1	SPDT relay
431-2	1	2-lug terminal strip	(56) 73-2	1	3/4" grommet
431-3	1	3-lug terminal strip	(57) 73-3	3	1/2" grommet
431-5	1	4-lug terminal strip	(58) 75-17	6	Bushing
431-35	2	7-lug terminal strip	(59) 75-24	1	Strain relief
434-15	1	7-pin wafer socket	(60) 75-60	1	Mica insulator
434-71	1	Lamp socket	(61) 89-1	1	Line cord
434-102	2	Transistor socket	207-2	1	Capacitor mounting clamp
434-117	3	Transistor socket	(62) 211-15	1	Black handle
462-187	4	Knob	260-24	1	Clip
<u>Hardware</u>			(63) 261-9	4	Rubber feet
250-1	1	2-56 x 1/8" self-tapping screw	344-59	1	Length hookup wire
250-175	4	2-56 x 3/8" screw	407-89	1	Meter
250-49	6	3-48 x 1/4" screw	(64) 412-25	1	6 watt 120 V lamp (6S6)
250-89	25	6-32 x 3/8" screw	421-25	1	1-1/2 ampere slow-blow fuse
250-26	10	6-32 x 5/8" screw	423-2	1	Fuse holder
250-137	4	8-32 x 3/8" screw	(65) 427-2	3	Binding post base
250-92	1	8-32 x 5/8" screw	481-3	1	Capacitor mounting wafer
250-83	2	#10 x 1/2" sheet metal screw	331-6		Solder
252-51	5	2-56 nut	595-516	1	Manual
252-1	6	3-48 nut	(66) 100-M16B	2	Black binding post cap
252-3	26	6-32 nut	100-M16R	1	Red binding post cap
252-4	5	8-32 nut			
252-7	5	Control nut			
252-22	4	#6 speednut			
253-1	4	#6 flat fiber washer			
253-2	3	#6 fiber shoulder washer			
253-9	4	#8 flat washer			
253-10	5	Control flat washer	<u>Sheet Metal</u>		
254-7	10	#3 lockwasher	200-M339	1	Chassis
254-1	36	#6 lockwasher	203-294F670-671-672		
254-2	5	#8 lockwasher		1	Front panel
254-4	2	Control lockwasher (large)	205-M397	1	Rear chassis mounting plate
254-5	2	Control lockwasher (small)	205-M398F-850		
259-1	4	#6 solder lug		1	Control mounting plate
259-10	1	Control solder lug	(67) 215-10	1	Heat sink
252-20	1	Control guard nut	(68) 215-8	1	Heat sink
			90-181	1	Cabinet

PROPER SOLDERING TECHNIQUES

a small percentage of customers find it necessary to return equipment for factory repair. By far the largest portion of malfunctions in this equipment are due to poor proper soldering.

Terminals are bright and clean and free of wax, old insulation and other foreign substances, difficulty will be experienced in soldering. Properly soldered connections are essential if performance engineered into a kit is to be realized. If you are a beginner with no experience in soldering, a half hour's practice with some odd lengths of wire may be a worthwhile investment.

For most wiring, a 25 to 100 watt iron or its equivalent in a soldering gun is very satisfactory. Higher wattage iron than this may not heat the connection enough to flow the solder smoothly. Keep the iron tip clean by wiping it from time to time with a cloth.


BASIC WIRING AND SOLDERING

Unless otherwise indicated, all wire used is the type with colored insulation (hookup wire). In preparing a length of hookup wire, 1/4" of insulation should be removed from each end unless directed otherwise in the assembly step.

To avoid breaking internal connections when stripping insulation from the leads of transformers or similar components, care should

be taken not to pull directly on the lead. Instead, hold the lead with pliers while it is being stripped.

3. Leads on resistors, capacitors, and similar components are generally much longer than need be to make the required connections. In these cases, the leads should be cut to proper length before the part is installed. In general, the leads should be just long enough to reach their terminating points.
4. Crimp or bend the lead (or leads) around the terminal to form a good joint without relying on solder for physical strength. If the lead is too large to allow bending or if the step states that it is not to be crimped, position it so that a good solder connection can still be made.
5. Position the work, if possible, so that gravity will help to keep the solder where you want it.
6. Then place the solder against the connection and it will immediately flow over the joint; use only enough solder to thoroughly wet the junction. It is usually not necessary to fill the entire hole in the terminal with solder.
7. Remove the solder and then the iron from the completed joint. Use care not to move the leads until the solder is solidified.

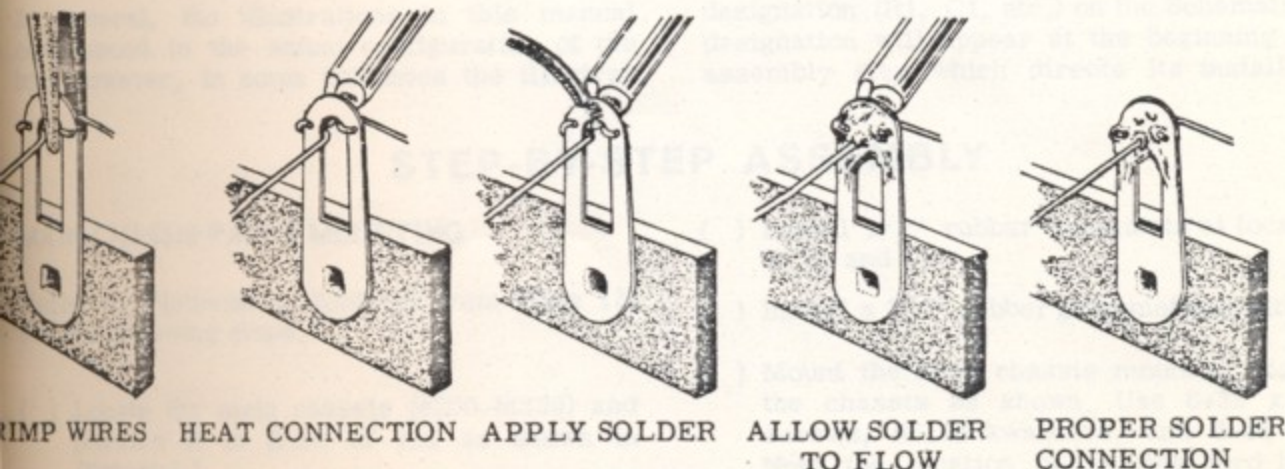



A poor or cold solder joint will usually look crystalline and have a grainy texture, or the solder will stand up in a blob and will not have adhered to the joint. Such joints should be reheated until the solder flows smoothly. In some cases, it may be necessary to add a little more solder to achieve a smooth, bright appearance.

ROSIN CORE SOLDER HAS BEEN SUPPLIED WITH THIS KIT. THIS TYPE OF SOLDER MUST BE USED FOR ALL SOLDERING IN THIS KIT. ALL GUARANTEES ARE VOIDED AND WE WILL NOT REPAIR OR SERVICE EQUIPMENT IN WHICH ACID CORE SOLDER OR PASTE FLUXES HAVE BEEN USED. IF ADDITIONAL SOLDER IS NEEDED, BE SURE TO PURCHASE ROSIN CORE (60:40 or 50:50 TIN-LEAD CONTENT) RADIO TYPE SOLDER.

STEP-BY-STEP PROCEDURE

The following instructions are presented in a logical step-by-step sequence to enable you to complete your kit with the least possible confusion. Be sure to read each step all the way through before beginning the specified operation. Also read several steps ahead of the actual step being performed. This will familiarize you with the relationship of the subsequent operations. When the step is completed, check it off in the space provided. This is particularly important as it may prevent errors or omissions, especially if your work is interrupted. Some kit builders have also found it helpful to mark each wire and part in colored pencil on the Pictorial as it is added.

ILLUSTRATIONS

The fold-out diagrams in this manual may be removed and attached to the wall above your working area; but because they are an integral part of the instructions, they should be returned to the manual after the kit is completed.

In general, the illustrations in this manual correspond to the actual configuration of the kit; however, in some instances the illustrations

may be slightly distorted to facilitate clearly showing all of the parts.

SOLDERING INFORMATION

The abbreviation "NS" indicates that a connection should not be soldered yet as other wires will be added. When the last wire is installed, the terminal should be soldered and the abbreviation "S" is used to indicate this. Note that a number will appear after each solder instruction. This number indicates the number of leads that are supposed to be connected to the terminal in point before it is soldered. For example, if the instruction reads, "Connect a wire to lug 1 (S-2)," it will be understood that there will be two wires connected to the terminal at the time it is soldered. (In cases where a wire passes through a terminal or lug and then connects to another point, it will count as two wires, one entering and one leaving the terminal.)

The steps directing the installation of resistors include color codes to help identify the parts. Also, if a part is identified by a letter-number designation (R1, C1, etc.) on the Schematic, its designation will appear at the beginning of the assembly step which directs its installation.

STEP-BY-STEP ASSEMBLY

MAIN CHASSIS PARTS MOUNTING

Refer to Pictorial 1 (fold-out from Page 13) for the following steps.

- () Locate the main chassis (#200-M339) and position it in front of you as shown in Pictorial 1.

- () Install 1/2" rubber grommets at locations H, K, and L.
- () Install a 3/4" rubber grommet at location D.
- () Mount the rear chassis mounting plate on the chassis as shown. Use 6-32 x 3/8" screws, #6 lockwashers, and 6-32 nuts. Note the location of the line cord hole.

Install a 6-32 speednut on each corner of the rear chassis mounting plate. Place the flat side of the speednut outward as shown.

Referring to Detail 1A, mount transistor sockets (#434-102) at locations X2 and X3. Use 2-56 x 3/8" screws, #3 lockwashers, and 2-56 nuts. Position lug 1 of each socket as shown by the arrows in Pictorial 1.


Mount the wafer tube socket at location V1. Use 3-48 x 1/4" screws, #3 lockwashers, and 3-48 nuts. Position the blank space as shown by the arrow.

Install the clip (#260-24) at location F. Use 2-56 x 1/8" screw and a 2-56 nut. Refer to Detail 1B.

E: When mounting terminal strips, place a lockwasher between each mounting foot and chassis, and one under each nut.



Detail 1B

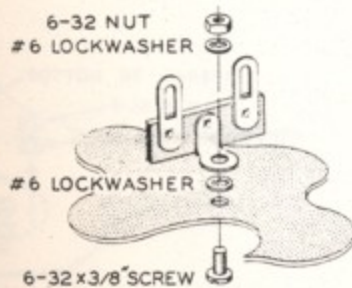


Detail 1C

Referring to Detail 1C, mount a 2-lug terminal strip at location N. Use a 6-32 x 3/8" screw, #6 lockwashers, and a 6-32 nut.

Mount a 4-lug terminal strip at location M. Use a 6-32 x 3/8" screw, #6 lockwashers, and a 6-32 nut.


Mount 7-lug terminal strips at locations E and G. Use 6-32 x 3/8" screws, #6 lockwashers, and 6-32 nuts.

Refer to Detail 1D and mount the electrolytic capacitor mounting wafer at location C with a 3-lug terminal strip on one mounting screw at location B. Use 6-32 x 3/8" screws, #6 lockwashers, and 6-32 nuts. The wafer goes on the side of the chassis opposite the terminal strip.

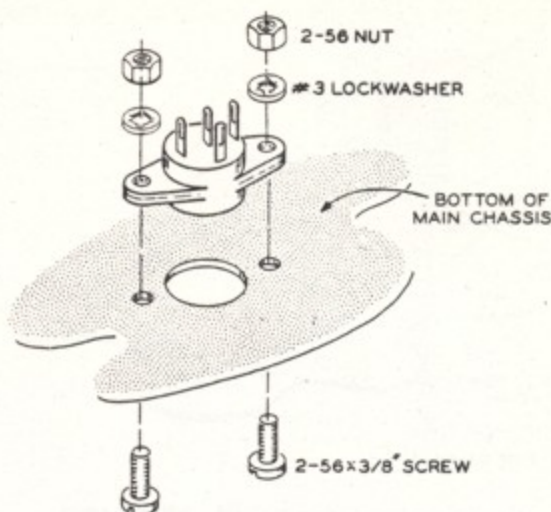

Detail 1A


- () C10, C9, C8. Refer to Detail 1D and mount the 100-40-40 μ fd electrolytic capacitor (#25-70) at location C. Secure the capacitor by twisting each mounting tab 1/8 turn with long-nose pliers. Position the capacitor lug markings as shown.

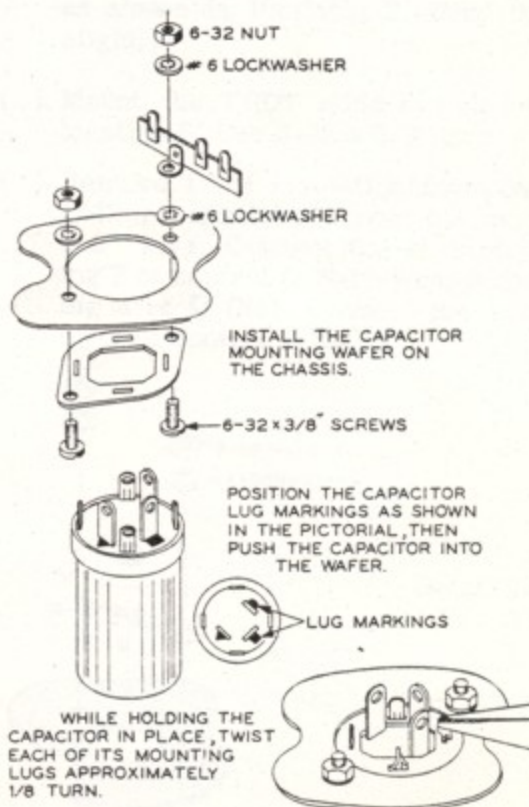


Detail 1D

- () Referring to Detail 1E, mount the electrolytic capacitor mounting clamp (#207-2) at location P. Use 6-32 x 3/8" screws, #6 lockwashers, and 6-32 nuts. Do not tighten the screws.
- () C2. Refer to Detail 1E and install the 3000 μ fd 75 V electrolytic capacitor in the mounting clamp. Position the capacitor lugs as shown in Pictorial 1. Secure it with an 8-32 x 5/8" screw, #8 lockwasher, and an 8-32 nut in the clamp as shown. Do not over-tighten this screw or you will damage the capacitor. Now tighten the three mounting screws.
- () Mount the relay (#69-13) at location J. Use two flat fiber washers, a fiber shoulder washer, #6 lockwasher, and a 6-32 nut as shown in Detail 1F.

Set this assembly aside until it is called for later.

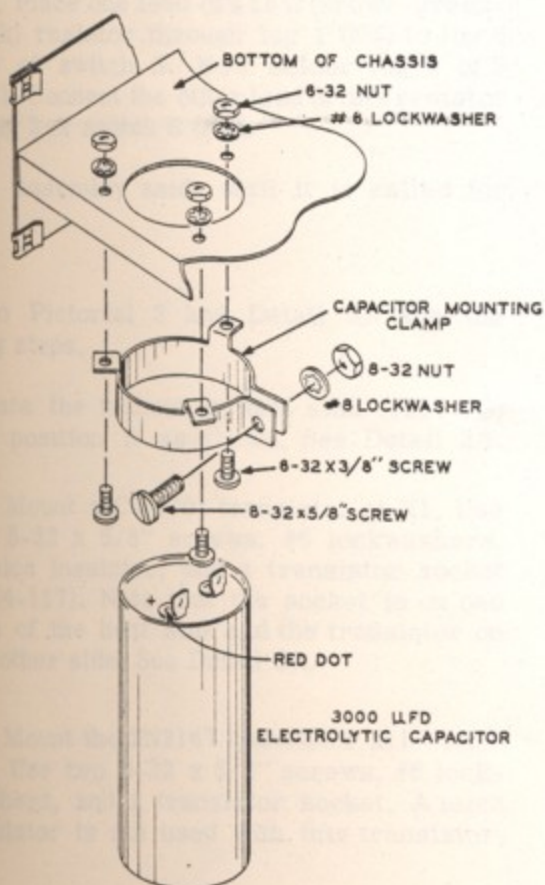

Detail 1E

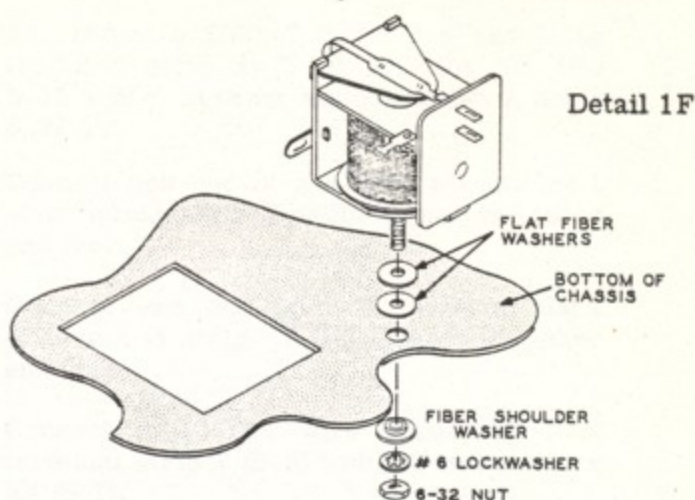


Detail 1F


CONTROL PLATE PARTS MOUNTING-WIRING

Refer to Pictorial 2 for the following steps.

- () Locate the control mounting plate (#205-M398F-850) and position it as shown.
- () R43, R47. Mount the 1 K Ω controls (#11-44) at locations Q and R. Use 3-48 x 1/4" screws, #3 lockwashers, and 3-48 nuts as shown in Detail 2A. Position the control lugs as shown in Pictorial 2. Bend the lugs up slightly.
- () Mount the TPDT slide switch (#60-16) at location S. Use 6-32 x 3/8" screws.
- () Remove 1" of insulation from one end and 1/4" of insulation from the other end of a 3" wire. Connect the 1" stripped end to lug 2 of control Q (S-1). Wrap it once around lug 3 of Q (NS). Connect the other end to lug 1 of control R (S-1).

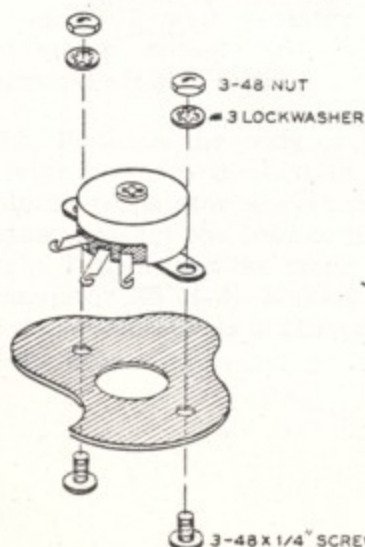

Detail 2A

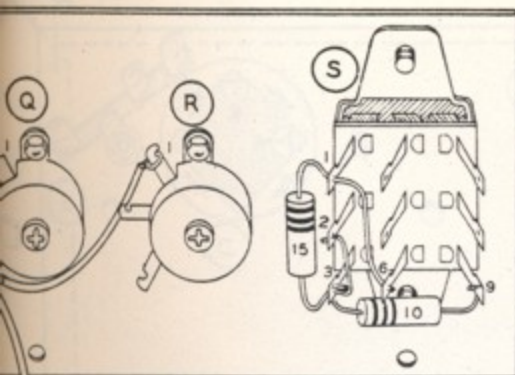

2-3/4" Pictorial 2

Connect a 2-3/4" wire to lug 3 of control Q (S-3). Leave the other end free.

R44. Connect one lead of a 10 Ω (brown-black-black) resistor to lug 9 of switch S (S-1). Run the other lead through lug 3 (NS) up to lug 2 (S-1) of switch S.

R45. Place one lead of a 15 Ω (brown-green-black) resistor through lug 1 (NS) to lug 6 (NS) of switch S. Now solder lug 1 of S (S-2). Connect the other lead of this resistor to lug 3 of switch S (NS).

this assembly aside until it is called for


to Pictorial 3 and Detail 3A for the wiring steps.

Locate the transistor heat sink (#215-10) and position it as shown. See Detail 3A.


X1. Mount a CQT701 transistor at X1. Use two 6-32 x 5/8" screws, #6 lockwashers, a mica insulator, and a transistor socket (#434-117). Note that the socket is on one side of the heat sink and the transistor on the other side. See Detail 3A.

X4. Mount the 2N2147 transistor at location X4. Use two 6-32 x 5/8" screws, #6 lockwashers, and a transistor socket. A mica insulator is not used with this transistor.


- () X5. Mount a 2N2147 transistor and 2-lug terminal strip at T at location X5. Use 6-32 x 5/8" screws, #6 lockwashers, and a 6-32 nut.
- () Connect one end of a 4-1/2" wire to lug 1 of terminal strip T (NS). Leave the other end free.
- () Connect one end of a 7" wire to lug 1 of terminal strip T (NS). Leave the other end free.
- () Connect a 1-3/4" wire from lug 1 of terminal strip T (S-3) to lug C of transistor X4 (S-1).
- () Connect a 2" wire from lug B of transistor X5 (NS) to lug B of transistor X4 (S-1).
- () Connect one end of a 8-1/2" wire to lug 2 of terminal strip T (NS). Leave the other end free.
- () Remove 1-1/4" of insulation from one end and 1/4" of insulation from the other end of a 4-3/4" wire. Connect the 1/4" stripped end to lug B of transistor X5 (NS). Leave the other end free.
- () Strip 1/4" of insulation from only one end of a 6-1/2" wire and connect this end to lug B of transistor X1 (S-1).
- () R49. Connect a .33 Ω (orange-orange-silver-gold) 2 watt resistor from lug E of transistor X4 (S-1) to lug 2 of terminal strip T (NS).
- () R50. Connect a .33 Ω (orange-orange-silver-gold) 2 watt resistor from lug E of transistor socket X5 (S-1) to lug 2 of terminal strip T (NS).
- () R23. Position the body of the 500 Ω thermistor down to the bottom of the indicated hole in transistor socket X5. Separate the leads; connect one lead to lug 2 of terminal strip T (S-4) and the other lead to lug B of transistor X5 (S-3). Make sure that the body of the thermistor is in contact with the bottom of the hole.

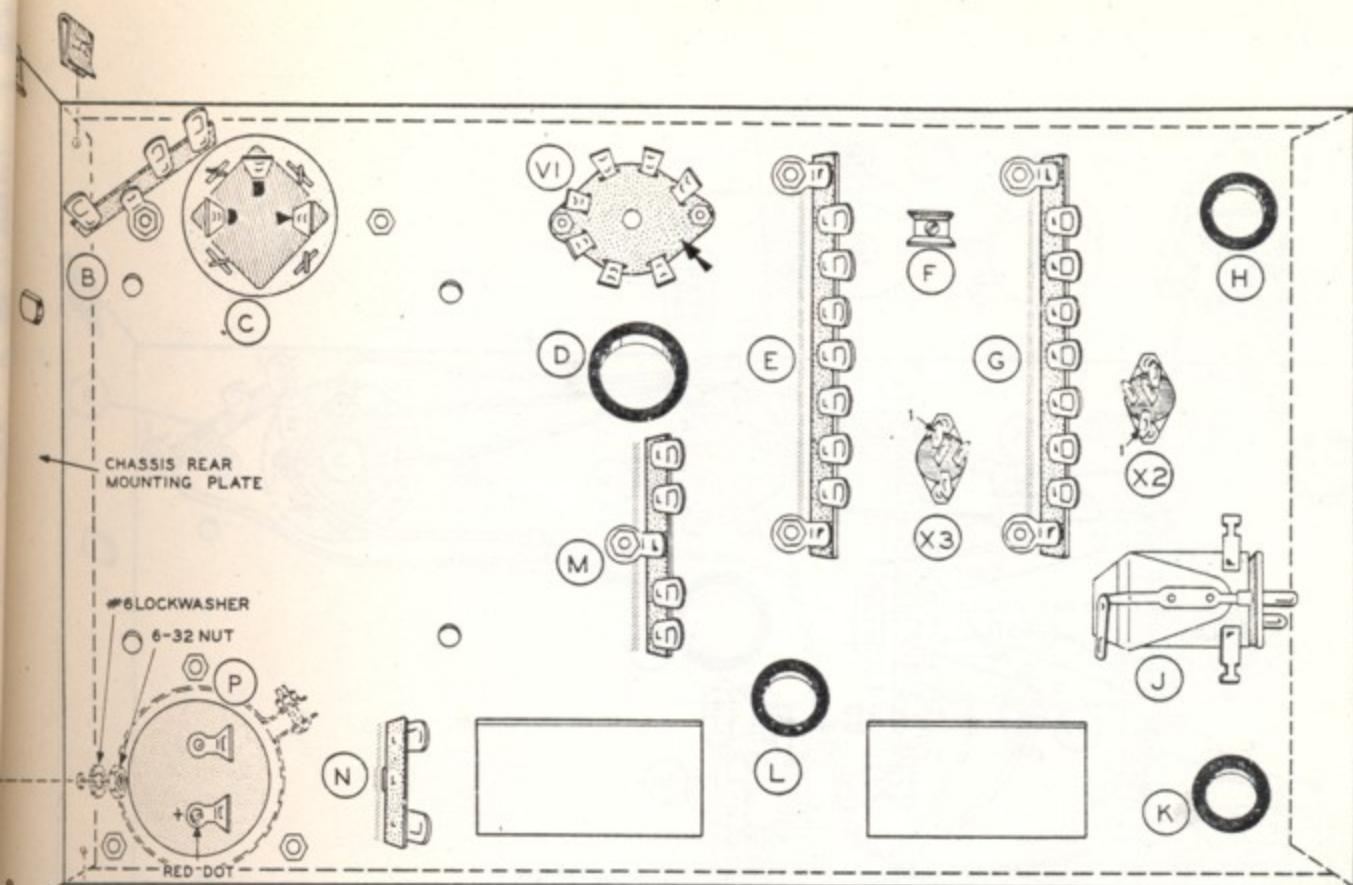


Pictorial 1

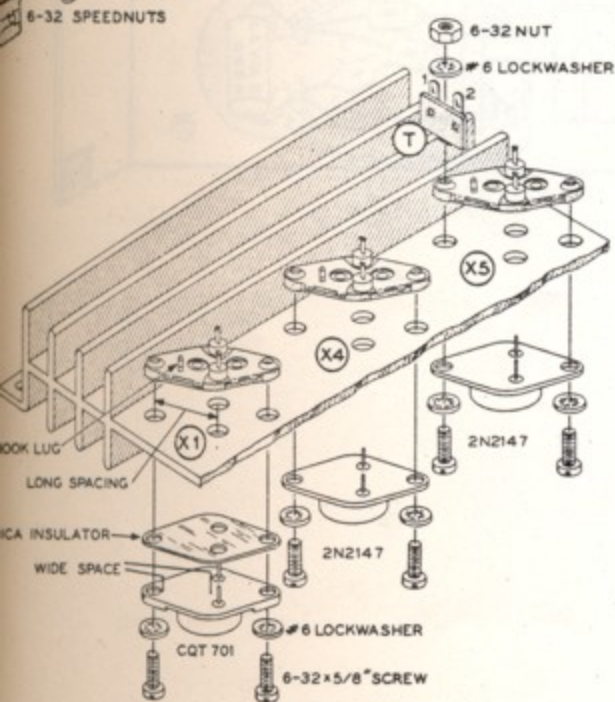

Detail 3A

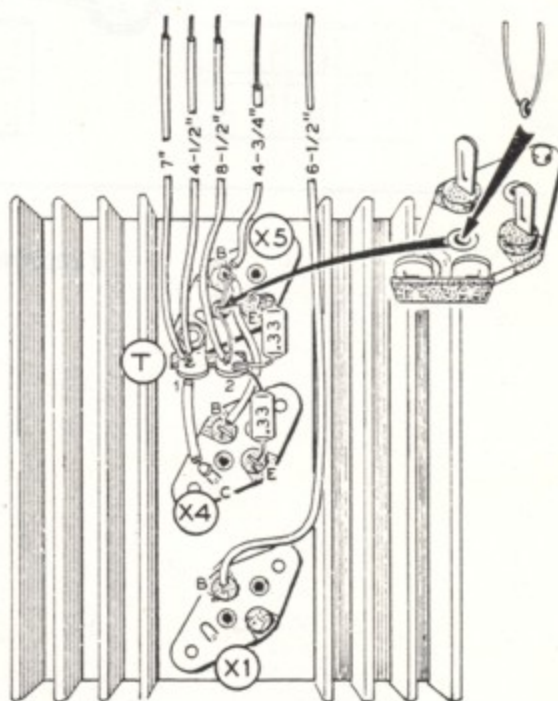

Pictorial 3

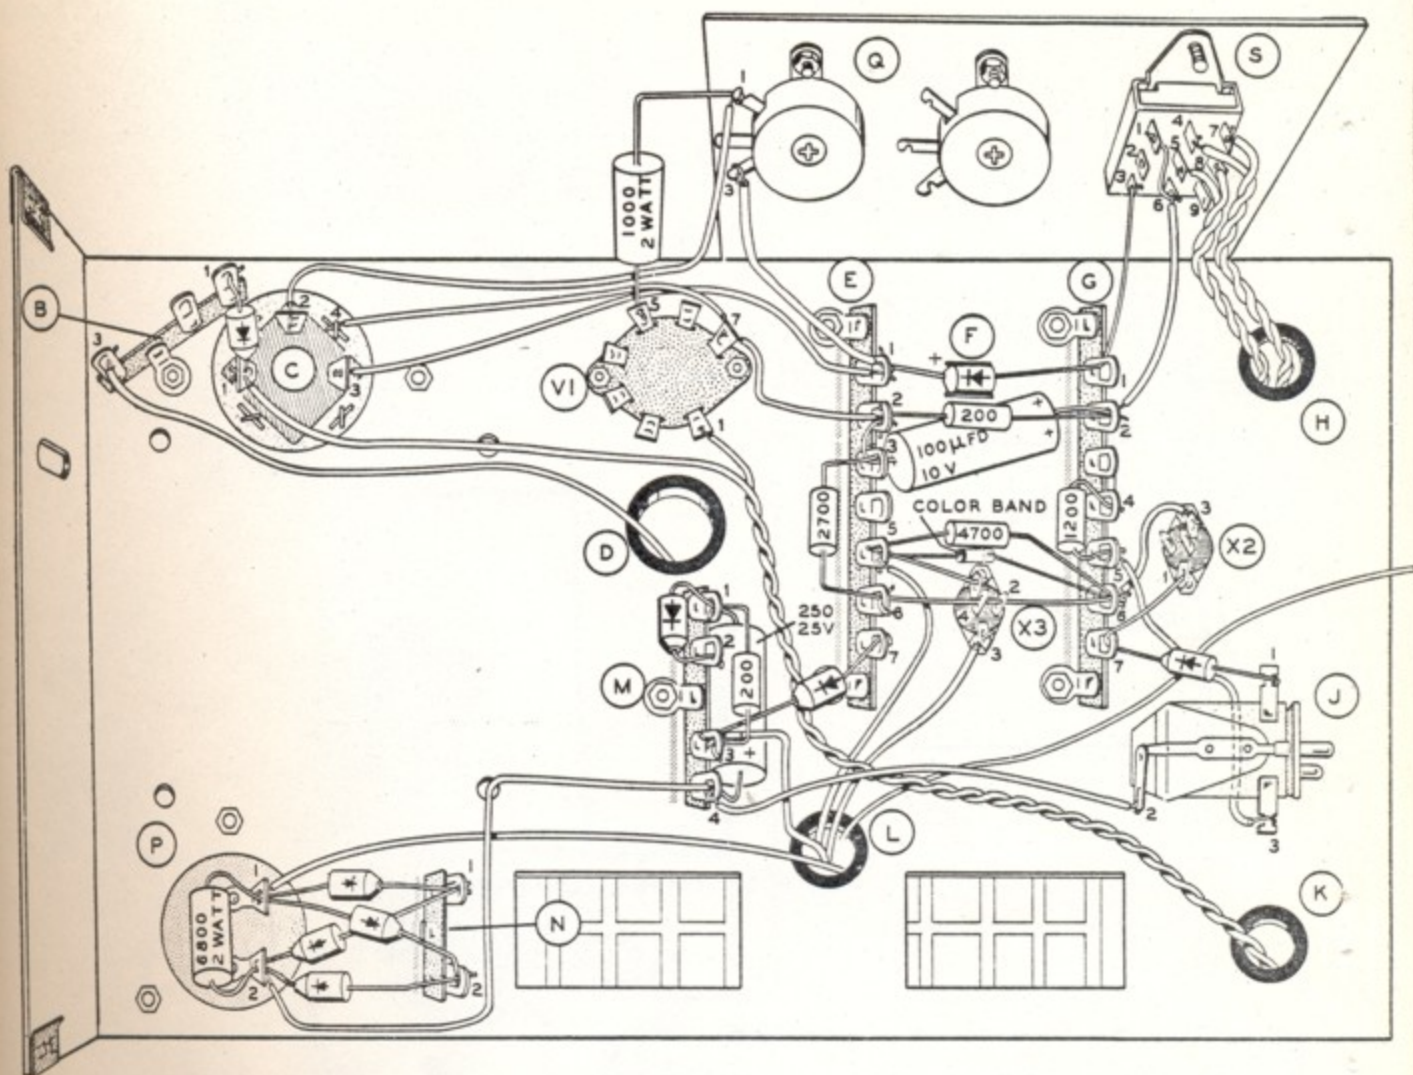

Pictorial 6


Set this assembly aside until it is called for later.

VOLTAGE RANGE SWITCH WIRING

Refer to Pictorial 4A for the following steps.

NOTE: In the following steps, all wires and components will be connected to lugs on the first wafer of the 11-position rotary switch (#63-297). All resistors called for in this manual are 1/2 watt unless otherwise specified in the steps.

Detail 4A

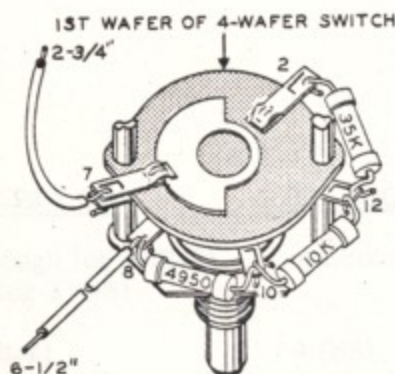

CONNECT A

() R21, 35 K Ω
(1% precision)

() R20, 10 K Ω
(1% precision)

() R19, 4950 Ω
(1% precision)

() 6-1/2" wire

() 2-3/4" wire

FROM LUG

2 (S-1)

12 (S-2)

10 (S-2)

8 (S-2)

7 (S-1)
solder both lugs.

TO LUG

12 (NS).

10 (NS).

8 (NS).


not connected.

not connected.

to Pictorial 4B for the following steps.

E: In the following steps, all wires and components will be connected to the lugs on the 2nd wafer of the 11-position rotary switch.

Detail 4B

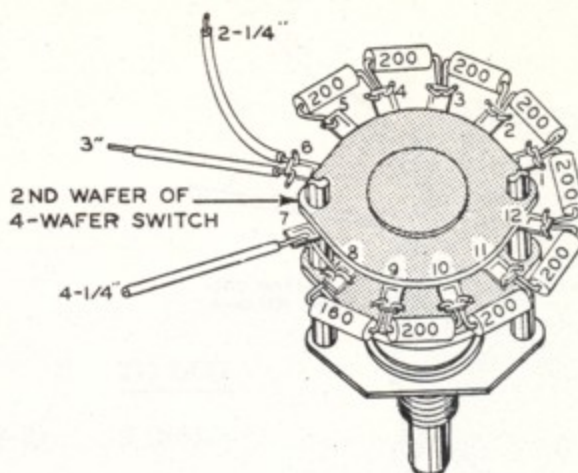

CONNECT A

FROM LUG

TO LUG

4-1/4" wire (strip one end only).	through lug 7 (S-2) to lug 8 (NS)	not connected.
R32, 160 Ω (brown-blue-brown)	8 (S-2)	9 (NS).
R31, 200 Ω (red-black-brown)	9 (S-2)	10 (NS).
R30, 200 Ω (red-black-brown)	10 (S-2)	11 (NS).
R29, 200 Ω (red-black-brown)	11 (S-2)	12 (NS).
R28, 200 Ω (red-black-brown)	12 (S-2)	1 (NS).
R27, 200 Ω (red-black-brown)	1 (S-2)	2 (NS).
R26, 200 Ω (red-black-brown)	2 (S-2)	3 (NS).
R25, 200 Ω (red-black-brown)	3 (S-2)	4 (NS).
R24, 200 Ω (red-black-brown)	4 (S-2)	5 (S-1).
2-1/4" wire	6 (NS)	not connected.
3" wire	6 (S-2)	not connected.

Refer to Pictorial 4C for the following steps.

NOTE: In the following steps, all wires and components will be connected to the lugs on the third wafer of the 11-position rotary switch.

CONNECT A

() R41, 160 Ω
(brown-blue-brown)

() R40, 200 Ω
(red-black-brown)

() R39, 200 Ω
(red-black-brown)

() R38, 200 Ω
(red-black-brown)

() R37, 200 Ω
(red-black-brown)

() R36, 200 Ω
(red-black-brown)

() R35, 200 Ω
(red-black-brown)

() R34, 200 Ω
(red-black-brown)

() R33, 200 Ω
(red-black-brown)

() 5-1/4" wire (strip 3/4" from free end)

() 3" wire (strip one end only)

() Referring to Pictorial 4D, connect one end of a 10" wire to both lugs 7 of the fourth wafer of the 11-position switch (S-1). Set this assembly aside until called for later.

FROM LUG

through lug 8 (S-2)
to lug 7 (S-1)

9 (S-2)

10 (S-2)

11 (S-2)

12 (S-2)

1 (S-2)

2 (S-2)

3 (S-2)

4 (S-2)

5 (S-2)

6 (S-1)

TO LUG

9 (NS).

10 (NS).

11 (NS).

12 (NS).

1 (NS).

2 (NS).


3 (NS).

4 (NS).


5 (NS).

not connected.

not connected

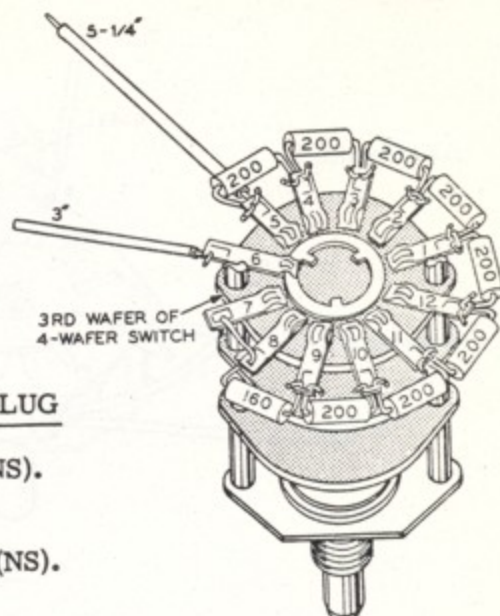

Detail 4C

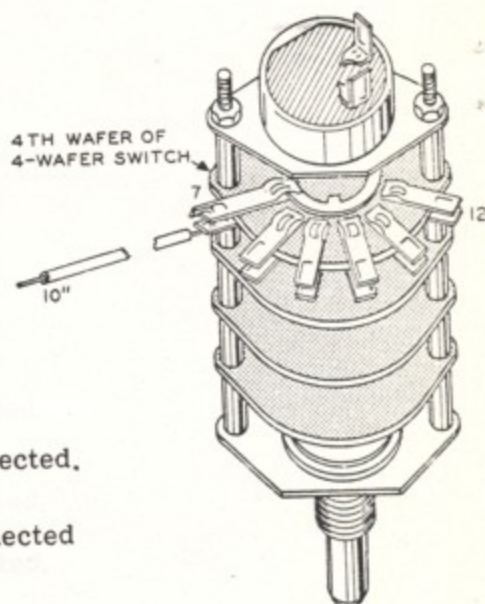


Detail 4D



Refer to Pictorial 5B for the following steps.

NOTE: In the following steps, all components and wires will be connected to the second wafer of the 4-position rotary switch.

CONNECT A	FROM LUG	TO LUG
() R6, 15 Ω (brown-green-black)	1 (S-1)	2 (NS).
() R7, 2.7 Ω 2 watt (red-violet-gold-gold)	2 (S-2)	3 (NS).
() R8, .82 Ω 2 watt (gray-red-silver-gold)	3 (S-2)	5 (NS).
() 3-1/4" wire (strip one end only)	5 (S-2)	not connected.
() R4, 9.1 Ω 2 watt (white-brown-gold)	6 (NS)	9 (NS).
() 9" wire	6 (S-2)	not connected.
() R5, 10 Ω (brown-black-black)	9 (NS)	11 (S-1).
() 3-1/2" wire	9 (S-3)	not connected.

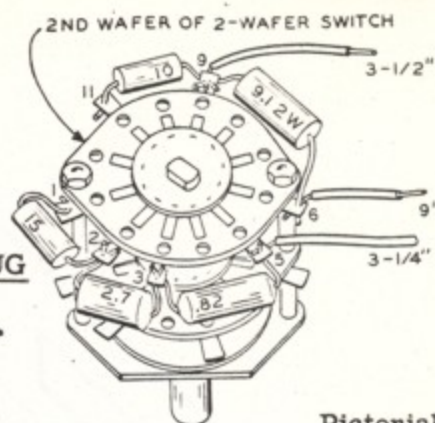

Pictorial 5B

Set this assembly aside until called for later.

INITIAL WIRING ON MAIN CHASSIS


Refer to Pictorial 6 (fold-out from Page 14) for the following steps.

- () Refer to Detail 6A and mount the control plate subassembly on the side of the main chassis. Use 6-32 x 3/8" screws, #6 lockwashers, and 6-32 nuts.
- () Refer to Detail 6A and mount the transistor heat sink assembly on the top side of the main chassis. Use 6-32 x 3/8" screws, #6 fiber shoulder washers, #6 fiber flat wash-

ers, #6 lockwashers and 6-32 nuts. Be sure to position transistor X1 (CQT701) as shown. Place all wires from the subassembly through grommet L. Make sure the heat sink clears the chassis at all places.

NOTE: The following steps concern the free ends of the wires extending through grommet L from the transistors on the heat sink.

- () Route the longest wire (from lug 2 of terminal strip T) as shown in Pictorial 6 and leave it free.

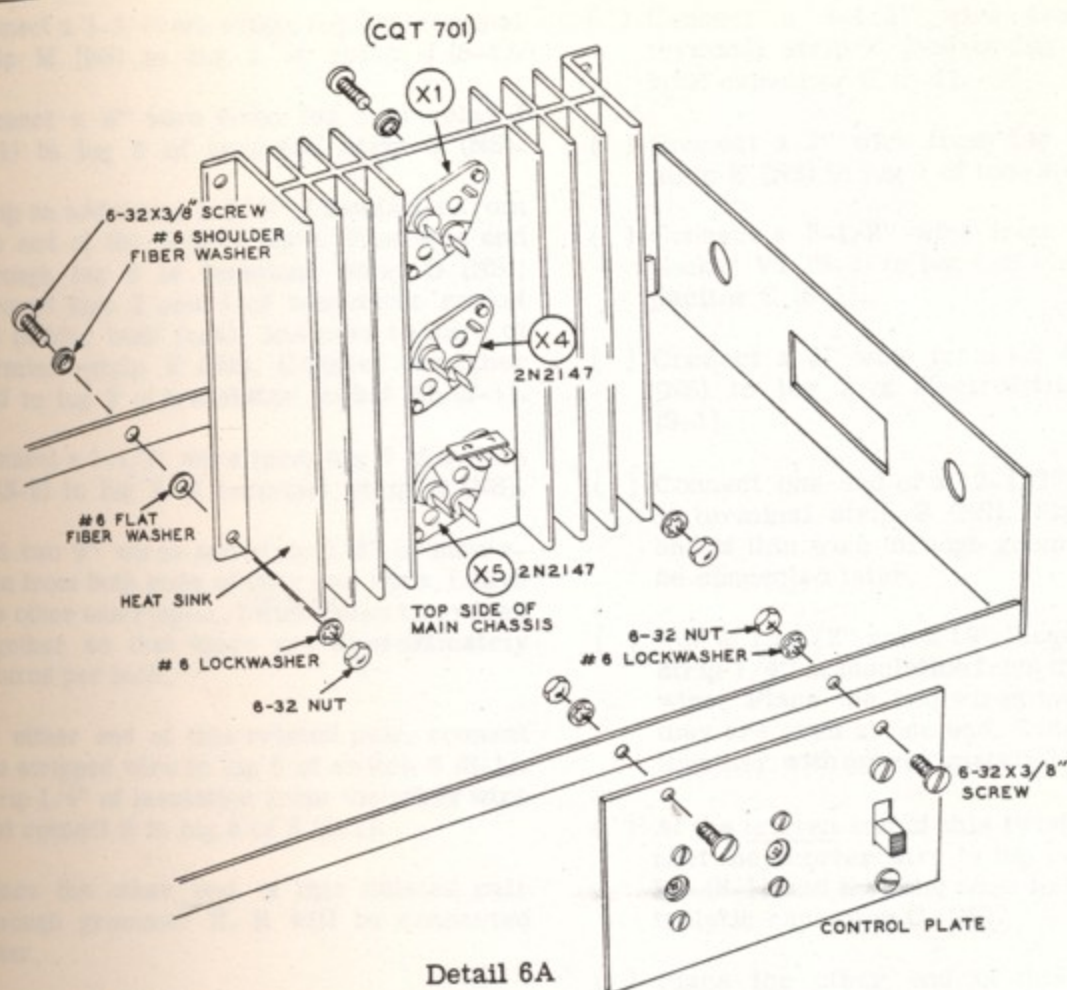

Connect the next longest stripped wire (from lug 1 of terminal strip T) to lug 1 of electrolytic capacitor P (NS).

Locate the wire stripped 1-1/4" (from lug B of X5). Run it through lug 5 of terminal strip E (NS), and then over to lug 1 of transistor socket X3 (S-1).

Strip 1/4" of insulation from the unstripped wire (from lug B of X1) and connect it to lug 3 of terminal strip M (NS).

Connect the remaining wire (from lug 1 of terminal strip T) to lug 3 of transistor socket X3 (S-1).

- () Cut the following lengths of hookup wire and strip 1/4" of insulation from each end. These wires are listed in the order that they will be used in the following steps.

5"
3-3/4"
4"
2-3/4"
1-1/2"

- () Connect a 5" wire from lug 2 of electrolytic capacitor P (NS) to lug 4 of terminal strip M (NS).

-) Connect a 3-3/4" wire from lug 4 of terminal strip M (NS) to lug 2 of relay J (S-1).
-) Connect a 4" wire from lug 3 of relay J (S-1) to lug 5 of terminal strip G (NS).
-) Strip an additional 1-1/4" of insulation from one end of the 2-3/4" wire. Pass this end through lug 6 of terminal strip G (NS), through lugs 2 and 4 of transistor socket X3 (solder both lugs), and over to lug 6 of terminal strip E (NS). Connect the other end to lug 3 of transistor socket X2 (S-1).
-) Connect a 1-1/2" wire from lug 6 of switch S (S-2) to lug 2 of terminal strip G (NS).
-) Cut two 9" wires and strip 1/4" of insulation from both ends of only one wire. Leave the other unstripped. Twist these two wires together so that there are approximately 3 turns per inch.
-) At either end of this twisted pair, connect the stripped wire to lug 5 of switch S (S-1). Strip 1/4" of insulation from the other wire and connect it to lug 8 of S (S-1).
-) Place the other end of this twisted pair through grommet H. It will be connected later.
-) Cut two 6-1/2" wires and strip 1/4" of insulation from only one of these wires. Twist these two wires together with approximately 3 turns per inch.
-) At either end of this twisted pair, connect the stripped lead to lug 4 of switch S (S-1). Strip 1/4" of insulation from the other wire and connect it to lug 7 of switch S (S-1).
-) Place the other end of this twisted pair through grommet H. It will be connected later.
-) Cut the following lengths of hookup wire and strip 1/4" of insulation from each end. These wires are listed in the order that they will be used in the following steps.

4-1/2"	5"
2"	12-1/2"
3-1/2"	

- () Connect a 4-1/2" wire from lug 1 of terminal strip E (NS) to lug 3 of electrolytic capacitor C (S-1).
- () Connect a 2" wire from lug 2 of terminal strip E (NS) to lug 7 of tube socket V1 (NS).
- () Connect a 3-1/2" wire from lug 7 of tube socket V1 (S-2) to lug 4 of electrolytic capacitor C (S-1).
- () Connect a 5" wire from lug 1 of control Q (NS) to lug 2 of electrolytic capacitor C (S-1).
- () Connect one end of a 12-1/2" wire to lug 3 of terminal strip B (NS). Place the other end of this wire through grommet D. It will be connected later.
- () Cut a 15-1/2" and a 19" length of wire and strip 1/4" of insulation from the ends of each wire. Place the two wires together so that they are even at one end. Twist these wires together with approximately 3 turns per inch.
- () At the uneven end of this twisted pair, connect the shorter wire to lug 1 of tube socket V1 (S-1) and the long wire to lug 1 of electrolytic capacitor C (NS).
- () Place the other end of this twisted pair through grommet K. It will be connected later.
- () D8. Locate the #57-27 diode which is packed in an individual bag. Refer to Detail 6B to determine the polarity. Then connect the cathode (K) lead to lug 1 of electrolytic capacitor C (S-2). Connect the other lead to lug 1 of terminal strip B (NS).

NOTE: WHEN INSTALLING SILICON DIODES, THE CATHODE END SHOULD BE PLACED AS DIRECTED. THE CATHODE END IS MARKED WITH EITHER COLOR END, COLOR DOT, OR COLOR BAND. IN THE ILLUSTRATION, THE SYMBOL K INDICATES THE CATHODE END.



Detail 6B

- () R48. Connect the 1000 Ω (brown-black-red) 2 watt resistor from lug 1 of control Q (S-2) to lug 5 of tube socket V1 (S-1).

21. Locate the 56 volt zener diode (#56-13, /R56) and place it in the clip as shown in Pictorial 6. Be sure that it is positioned as shown and setting flat on the bottom of the clip.

Connect the (+) lead (cathode) of the zener diode to lug 1 of terminal strip E (NS). Place the other lead of the diode through lug 1 of terminal strip G (NS) up to lug 3 of switch S (S-4). Now solder lug 1 of G (S-2).

Connect the lead extending from lug 3 of control Q to lug 1 of terminal strip E (S-3).

C7. Connect the positive (+) lead of a 100 μ fd 10 V electrolytic capacitor to lug 2 of terminal strip G (NS). Pass the other lead of this capacitor through lug 3 of terminal strip E (NS) and connect it to lug 2 of terminal strip E (NS).

R46. Connect a 200 Ω (red-black-brown) resistor from lug 2 of terminal strip G (NS) to lug 2 of terminal strip E (S-3).

R9. Connect one lead of a 2700 Ω (red-violet-red) resistor to lug 3 of terminal strip E (S-3). Connect the other lead of this resistor to lug 6 of E (S-2).

D9. Connect the germanium diode (clear body) from lug 5 of terminal strip E (NS) to lug 6 of terminal strip G (NS). The cathode (K) lead from the color band end must go to terminal strip E.

R22. Connect a 4700 Ω (yellow-violet-red) resistor from lug 5 of terminal strip E (S-4) to lug 6 of terminal strip G (S-4).

R17. Connect a 1200 Ω (brown-red-red) resistor from lug 5 (NS) to lug 4 (NS) of terminal strip G.

D7. Place the cathode (K) lead of a silicon diode (#57-29) (one of seven) through lug 7 of terminal strip G (NS) over to lug 1 of transistor socket X2 (S-1). Connect the other lead to lug 1 of relay J (S-1).

() D5. Connect the cathode (K) lead of a silicon diode (#57-29) to lug 2 (NS) and the other lead to lug 1 (NS) of terminal strip M.

() C1. Connect the positive (+) lead of a 250 μ fd 25 V electrolytic capacitor to lug 4 (S-3) and the other lead to lug 1 (NS) of terminal strip M.

() R1. Connect a 200 Ω (red-black-brown) resistor between lugs 1 (S-3) and 3 (NS) of terminal strip M.

() D6. Connect the cathode (K) lead of a silicon diode (#57-29) to lug 3 of terminal strip M (S-3) and the other lead to lug 7 of terminal strip E (NS).

() R3. Connect a 6800 Ω (blue-gray-red) 2 watt resistor between lugs 1 (NS) and 2 (NS) of electrolytic capacitor P.

NOTE: In the following steps, position the diodes as shown in Pictorial 6. Refer to Detail 6B to determine the polarity.

() D3. Connect the cathode (K) lead of a silicon diode (#57-29) to lug 1 of terminal strip N (NS) and the other lead to lug 1 of electrolytic capacitor P (NS).

() D2. Connect the cathode (K) lead of a silicon diode (#57-29) to lug 2 of electrolytic capacitor P (NS) and the other lead to lug 1 of terminal strip N (NS).


() D4. connect the cathode (K) lead of a silicon diode (#57-29) to lug 2 of terminal strip N (NS) and the other lead to lug 1 of electrolytic capacitor P (S-4).

() D1. Connect the cathode (K) lead of a silicon diode (#57-29) to lug 2 of electrolytic capacitor P (NS) and the other lead to lug 2 of terminal strip N (NS).


This completes the Initial Wiring on the main chassis. Set this assembly aside until it is called for later.

Refer to Pictorial 7 for the following steps.

-) Locate the front panel and position it as shown. Place a cloth on your work area to protect the panel finish.
-) Refer to Detail 7A and mount the three binding posts at locations FG, FH, and FJ. Use two solder lugs on FH and one each on FG and FJ. Position the solder lugs as shown in Pictorial 7. Point lug FJ to the hole at FK. Position the holes in the binding post bases parallel to the bottom edge of the front panel.

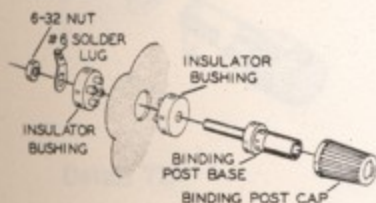


Detail 7A

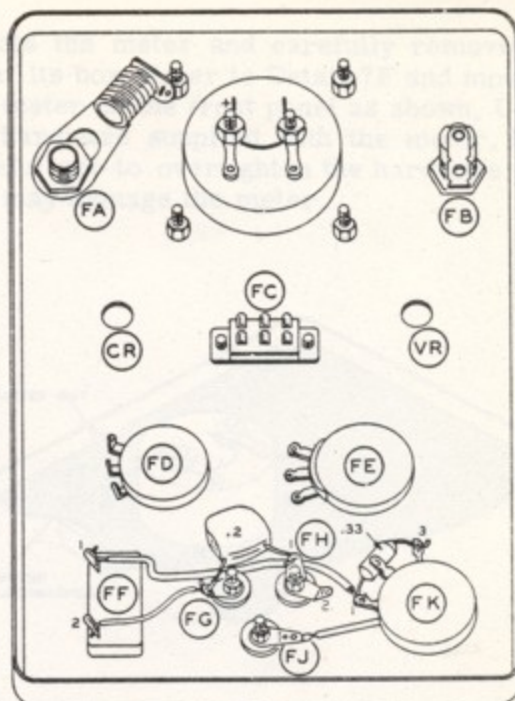


Pictorial 7

- () R16. Place a control solder lug on the bushing of the 50 Ω control (#11-21) and straighten out the solder lug. Mount this control at location FK. Use a control flat washer and a control nut. See Detail 7B. Position the control lugs as shown. Make sure that the solder lug touches the lug on FJ.

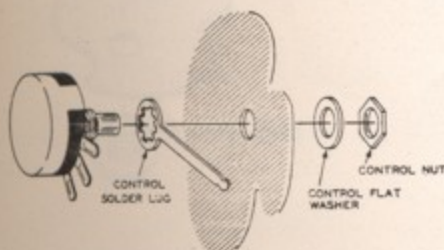

Detail 7B

- () R2. Mount the 30 Ω control (#11-47) at location FD. Use a large control lockwasher, control flat washer, and a control nut. Position the control lugs as shown.
- () Refer to Detail 7C and mount the SPST toggle switch (#61-9) at location FF. Use the hardware supplied with the switch for mounting. Space the switch, using the spacing nut as shown. Position the switch lugs as shown in Pictorial 7.

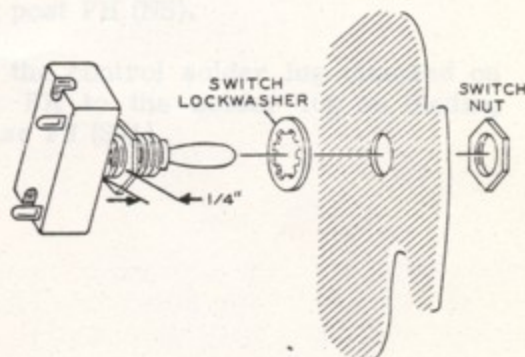


Detail 7C

- () R42. Mount the 240 Ω control (#11-45) at location FE. Use a large control lockwasher, a control flat washer, and a control nut. Position the control lugs as shown.


Mount the DPDT slide switch (#60-2) at location FC. Use two 6-32 x 3/8" screws.

Refer to Detail 7D and mount the fuse holder at location FB. Use the hardware supplied with the holder. Position the lugs as shown in Pictorial 7.

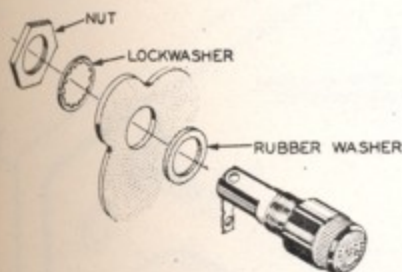


Detail 7D

Refer to Detail 7E and mount the lamp socket assembly at location FA. Position the socket as shown in Pictorial 7.

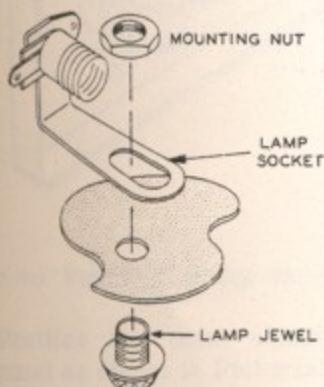


Detail 7E

- () Locate the meter and carefully remove it from its box. Refer to Detail 7F and mount the meter on the front panel as shown. Use the hardware supplied with the meter. Be careful not to overtighten the hardware as you may damage the meter.

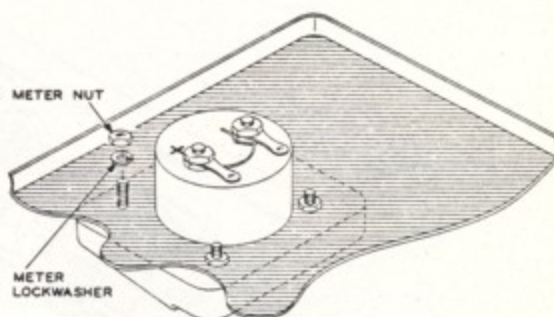

Detail 7F

- () Connect a 5" wire from lug 1 of switch FF (NS) to lug 1 of control FK (NS).
- () Connect a 3" wire from lug 2 of switch FF (S-1) to binding post FG (NS).
- () R18. Connect a .33 Ω (orange-orange-silver-gold) 2 watt 5% resistor between lugs 1 (S-2) and 3 (NS) of control FK.
- () C5. Connect a .2 μ fd mylar capacitor from binding post FG (NS) to solder lug 1 on binding post FH (NS).
- () Solder the control solder lug mounted on control FK to the solder lug on binding post base FJ (S-1).

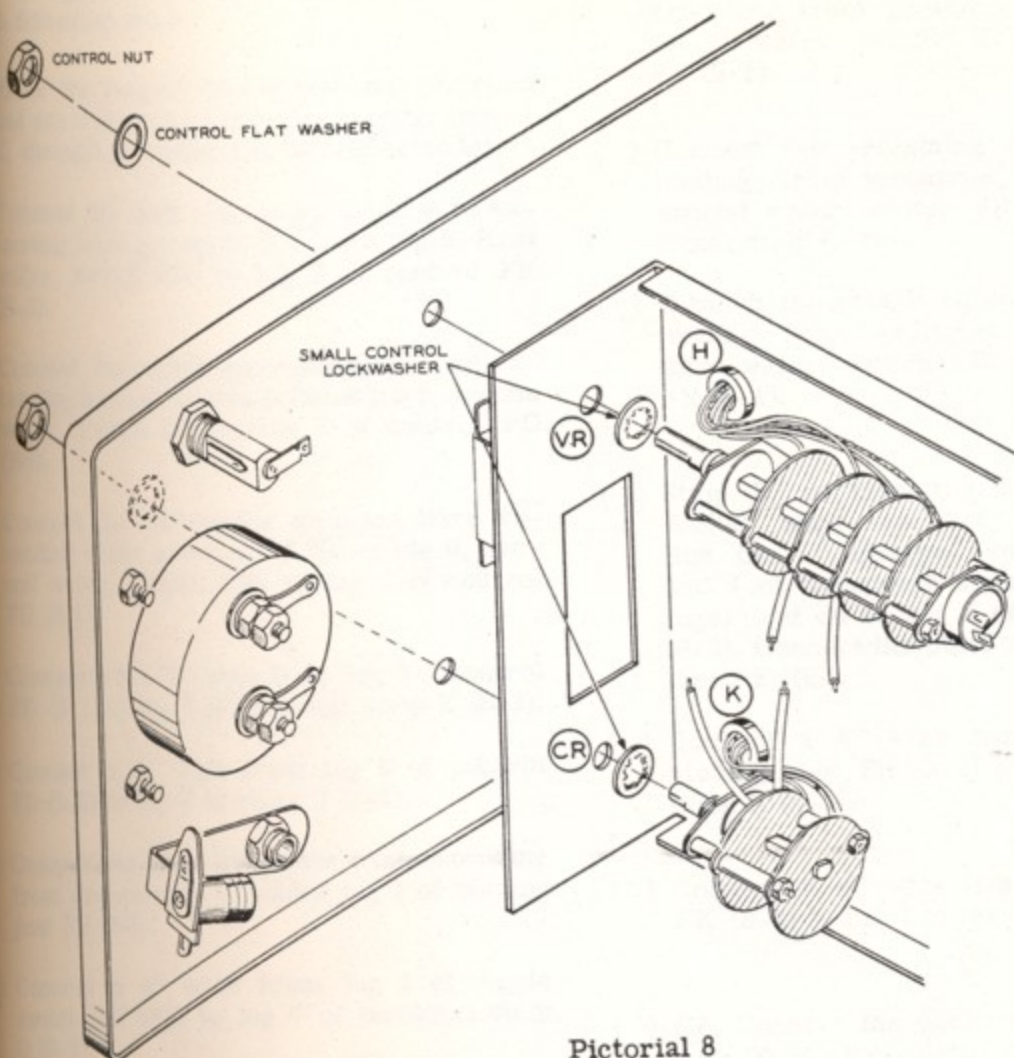

Pictorial 8

Refer to Pictorial 8 for the following steps.

- () Position the main chassis on the front panel as shown in Pictorial 8.
- () Mount the CURRENT RANGE switch at location CR. Use a small control lockwasher, a control flat washer, and a control nut. Place the free ends of the wires extending from switch CR except for the shorter wire from lug 4 and the wire from lug 9 of the first wafer, through grommet K. Position the switch lugs and wires as shown.
- () Mount the VOLTAGE RANGE switch at location VR. Use a small control lockwash-

er, control flat washer, and a control nut. Place the free ends of the wires extending from the switch, except the wire from lug 7 of the first wafer and the shorter wire from lug 6 of the second wafer, through grommet H. Position the switch lugs and wires as shown.

- () Install knobs on the VOLTAGE RANGE switch and CURRENT RANGE switch. Tighten each setscrew and make sure the pointer lines will point to all the dots on the front panel as each switch is rotated through every range. If necessary, loosen the nut to rotate each switch and then retighten.

to Pictorial 9 (fold-out from Page 29) the following steps.

Place the longest two wires, one stripped and one unstripped, extending from grommet K, through grommet L to be connected later.

Connect the next longest stripped wire extending from grommet K (from lug 6, first wafer, switch CR) to lug 3 of control FK (S-2).

Connect the remaining unstripped wire extending from grommet K (from lug 5, second wafer, switch CR) to lug 3 of control FD (NS).

Connect the remaining stripped wire extending from grommet K (from lug 9, second wafer, switch CR) to lug 1 of control FD (S-1).

Connect a 5-1/2" wire from lug 2 of control FD (S-1) to lug 7 of terminal strip E (S-2).

Connect a 2" wire from lug 3 of control FD (S-2) to lug 4 of relay J (S-1).

Connect the free end of the wire extending from grommet L to solder lug 1 of binding post FH (NS).

Connect a 4" wire from lug 1 of toggle switch FF (NS) to lug 7 of terminal strip G (S-3).

Connect the free end of the longest stripped wire extending from grommet H (from lug 7 fourth wafer, switch VR) to lug 2 of terminal strip N (S-3).

Connect the free end of the next longest stripped wire extending from grommet H (from lug 8, first wafer, switch VR) to binding post base FG (S-3).

Locate the next longest stripped wire extending from grommet H (from lug 5, third wafer, switch VR). Pass it next to lug 3 (NS) and on to lug 2 (S-1) of control R. Now solder the lead to lug 3 (S-2).

() Connect the next longest unstripped wire extending from grommet H (from lug 7, second wafer, switch VR) to lug 3 of control FE (S-1).

() Connect the remaining stripped wire extending from grommet H (from lug 6, second wafer, switch VR) to lug 2 of terminal strip G (NS).

() Connect the remaining unstripped wire extending from grommet H (from lug 6, third wafer, switch VR) to lug 1 of control FE (S-1).

() Strip 1" of insulation from one end of a 3-3/4" wire and 1/4" from the other. Run the 1" stripped end through lugs 2 and 4 of transistor socket X2 (solder both lugs) and on to lug 5 of terminal strip G (S-3). Connect the other end to lug 2 of control FE (NS).


() Connect a 4" wire from solder lug 1 of binding post FH (S-3) to lug 2 of terminal strip G (S-5).

() Connect a 4" wire from lug 2 of control FK (S-1) to lug 4 of terminal strip G (S-2).

() C6. Connect the positive (+) lead of a 100 μ fd 50 V electrolytic capacitor (#25-128) to lug 2 of control FE (S-2). Connect the other lead to solder lug 2 of binding post FH (NS).

() C4. Connect the positive (+) lead of a 500 μ fd 50 V electrolytic capacitor (#25-121) to lug 1 of toggle switch FF (S-3) and the other lead to solder lug 2 of binding post FH (S-2).

() Locate the power transformer (#54-123) and place it on a flat surface. Make sure that the mounting feet are flat so that when the transformer is mounted it will not distort the chassis.

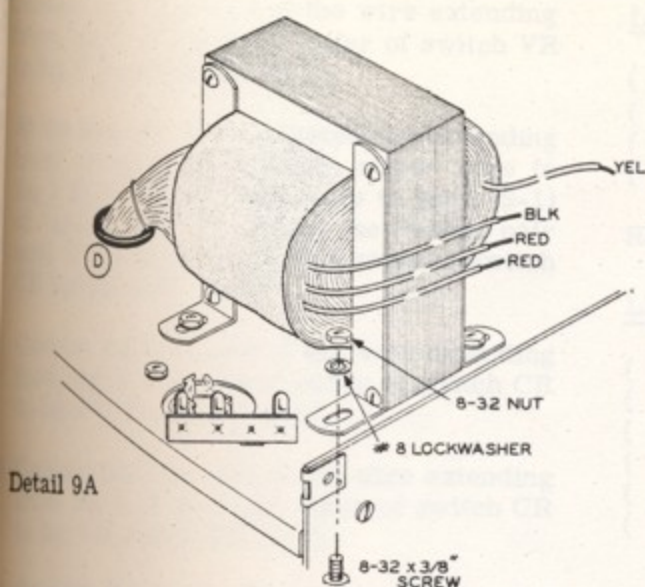

Detail 9A

() Refer to Detail 9A and mount the power transformer to the main chassis. Position the transformer so that the yellow, black and red leads are as shown. Secure the transformer with 8-32 x 3/8" screws, #8 lockwashers, and 8-32 nuts.

() Place all leads extending from the power transformer nearest grommet D through grommet D. They will be connected later. Bundle the wires as shown with a piece of hookup wire.

NOTE: Strip and tin each transformer lead after cutting it to the proper length. See Pictorial 9.

() Connect either red power transformer lead to lug 5 of electrolytic capacitor C (S-1).


() Connect the remaining red power transformer lead to lug 1 of terminal strip B (S-2).

() Connect the black power transformer lead to lug 2 of terminal strip B (NS).

() Connect the orange power transformer lead to lug 1 of terminal strip N (S-3).

() Connect the yellow power transformer lead nearest the orange lead to lug 2 of terminal strip M (S-2).

() Connect the remaining yellow power transformer lead to lug 2 of electrolytic capacitor P (S-5).

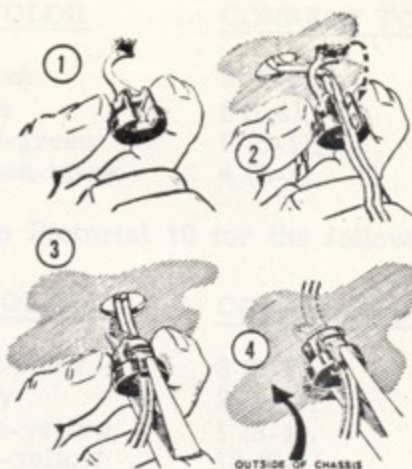

Detail 9B

() Place the line cord through the chassis and connect either line cord wire to lug 2 of terminal strip B (S-2).

() Connect the remaining line cord wire to lug 3 of terminal strip B (S-2).

() Refer to Detail 9B and install the line cord strain relief.

This completes wiring under the chassis.

FINAL WIRING ON MAIN CHASSIS TOP

Refer to Pictorial 10 for the following steps.

() Connect the stripped wire of the shorter twisted pair extending through grommet H to lug 5 of switch FC (S-1).

() Strip 1/4" of insulation from the other twisted wire and connect it to lug 2 of switch FC (S-1). Route the twisted pair along the front chassis flange.

() Connect the stripped wire of the remaining twisted pair extending from grommet H to lug 2 of the meter (S-1).

() Strip 1/4" of insulation from the other wire and connect it to lug 1 of the meter (S-1). Place the twisted pair close to the front panel and front chassis flange.

() Remove the spring clip from between the meter terminals.

() Connect the free end of the wire extending from lug 6 of the second wafer of switch VR to lug 6 of switch FC (S-1).

Connect the free end of the wire extending from lug 7 of the first wafer of switch VR to lug 3 of switch FC (S-1).

At the free end of the twisted pair extending from grommet K, connect either wire to lug 1 (S-1) and the other wire to lug 2 (S-1) of lamp socket FA. Place the twisted pair next to the front panel, and between switch CR and the front panel.

Connect the free end of the wire extending from lug 9 of the first wafer of switch CR to lug 4 of switch FC (S-1).

Connect the free end of the wire extending from lug 4 of the first wafer of switch CR to lug 1 of switch FC (S-1).


Connect the free end of the hookup wire extending from grommet D to lug 2 of fuse holder FB (S-1).

Connect a 3-1/2" wire from lug 1 of fuse holder FB (S-1) to the upper lug of the AC switch on the rear of switch VR (S-1).

NOTE: When connecting the transformer leads, be sure to cut them to length so that they may be bundled neatly as shown in Pictorial 10.

Connect the black lead from grommet D to the remaining lug of the AC switch on the rear of switch VR (S-1).

Refer to Detail 10A and connect the power transformer leads extending from grommet D to the lugs on the fourth wafer of switch VR as follows. Be sure to solder both lugs at each switch connection.

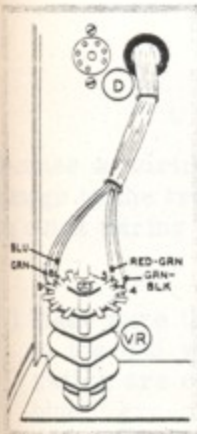

Detail 10A

LEAD COLOR

- () Green
- () Blue
- () Red-green
- () Green-black

CONNECT TO LUG

- 9 (S-1).
- 8 (S-1).
- 5 (S-1).
- 4 (S-1).

Refer to Pictorial 10 for the following steps.

LEAD COLOR


- () Red-black
- () Gray
- () Blue-yellow
- () Red-yellow
- () Green-yellow
- () Black-yellow

CONNECT TO LUG


- 3 (S-1).
- 2 (S-1).
- 1 (S-1).
- 12 (S-1).
- 11 (S-1).
- 10 (S-1).

- () Connect the free end of the stripped wire extending through grommet L (from lug 6, second wafer, switch CR) to lug E on transistor socket X1 (S-1).
- () Connect the unstripped wire extending from grommet L (from lug 4, first wafer, switch CR) to lug C of transistor socket X1 (S-1).

This completes all wiring. Check all connections.

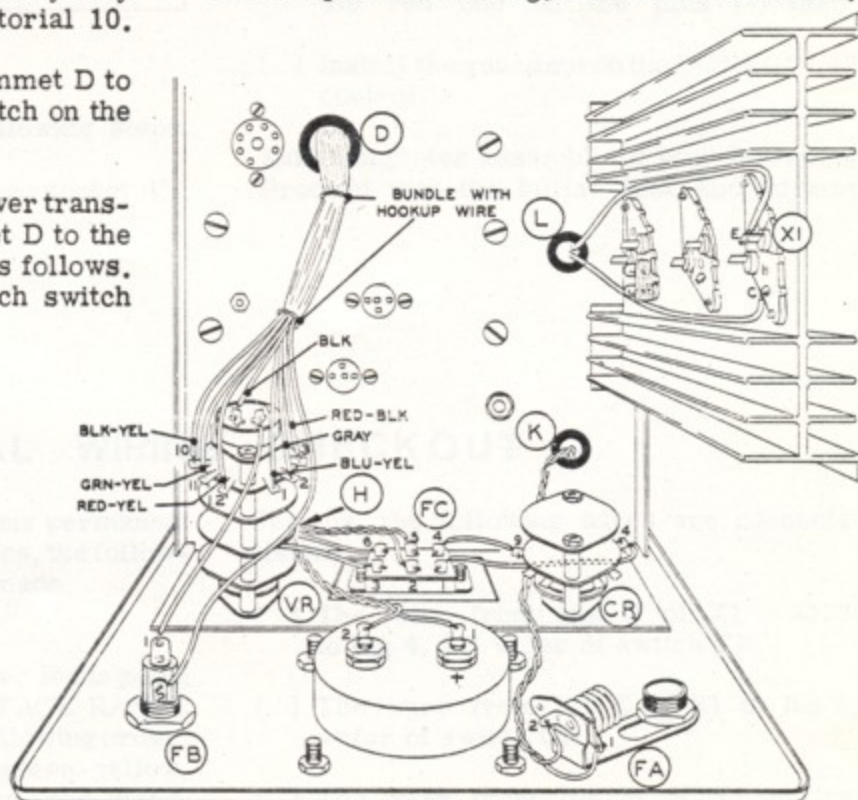

Pictorial 10

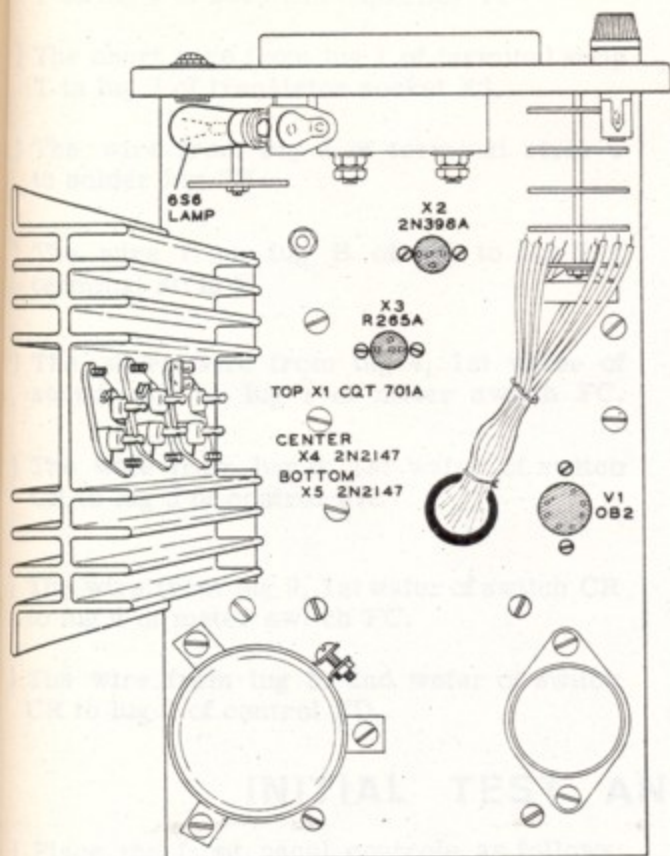

Pictorial 11

Refer to Pictorial 11 for the following steps.

- () Install the OB2 tube in tube socket V1.

- () Install the R265A transistor in transistor socket X3, after clipping the transistor leads to 1/4".
- () Place the small transistor heat sink on the 2N398A transistor. Now clip off the transistor leads to 1/4".
- () Install this transistor in transistor socket X2.
- () Install the 6 watt, 120 volt lamp in the lamp socket.
- () Install a 1-1/2 ampere fuse in the fuse holder.

Refer to Pictorial 12 for the following steps.

- () Install knobs on the FINE VOLTAGE and CURRENT LIMIT controls. Position the knob pointers straight up, with the control shafts at the center of their rotation.
- () Install the three binding post caps. Place the red one on the plus (+) terminal.
- () Install the guard nut on the DC REGULATION control.

This completes assembly of your Power Supply. Proceed with the Initial Test And Adjustment.

FINAL WIRING CHECKOUT

Because a wiring error may cause permanent damage to the transistors and diodes, the following quick wiring check should be made.

- () Make sure that the transformer leads going to the 4th wafer of the VOLTAGE RANGE switch are connected in the following order: blue, green, black-yellow, green-yellow, red-yellow, blue-yellow, gray, red-black, green-black, and red-green.

See that the following wires are connected as listed:

- () The wire from lug C of X1 (CQT701A) to lug 4, 1st wafer of switch CR.
- () The wire from lug E of X1 to lug 6, 2nd wafer of switch CR.
- () The wire from lug B of X1 to lug 3 of terminal strip M.

() The wire from lug E of X1 to lug 6, 2nd wafer of switch CR.

() The wire from lug B of X1 to lug 3 of terminal strip M.

-) The long wire from lug 1 of terminal strip T to lug 1 of 3000 μ fd capacitor P.
 -) The short wire from lug 1 of terminal strip T to lug 3 of transistor socket X3.
 -) The wire from lug 2 of terminal strip T to solder lug FH.
 -) The wire from lug B of X5 to lug 5 of terminal strip E.
 -) The short wire from lug 4, 1st wafer of switch CR to lug 1 of meter switch FC.
 -) The wire from lug 6, 1st wafer of switch CR to lug 3 of control FK.
 -) The wire from lug 9, 1st wafer of switch CR to lug 4 of meter switch FC.
 -) The wire from lug 5, 2nd wafer of switch CR to lug 3 of control FD.
 - () The wire from lug 9, 2nd wafer of switch CR to lug 1 of control FD.
 - () Wire from lug 7, 1st wafer of switch VR to lug 3 of meter switch FC.
 - () The wire from lug 8, 1st wafer of switch VR to solder lug FG.
 - () The wire from lug 6, 2nd wafer of switch VR to lug 2 of terminal strip G.
 - () The wire from lug 7, 2nd wafer of switch VR to lug 3 of control FE.
 - () The wire from lug 5, 3rd wafer of switch VR to lugs 2 and 3 of control R.
 - () The wire from lug 6, 3rd wafer of switch VR to lug 1 of control FE.
 - () The wire from lug 7, 4th wafer of switch VR to lug 2 of terminal strip N.
- This completes the wiring checkout.

INITIAL TEST AND ADJUSTMENT


-) Place the front panel controls as follows:

VOLTAGE RANGE - AC OFF
 CURRENT RANGE - 1.5 A
 FINE VOLTAGE - Center of rotation
 CURRENT LIMIT - MAX CURRENT
 METER - Voltage
 DC REGULATION - 1/8 turn from full counterclockwise
 Toggle Switch- RESET STANDBY


-) Set the controls on the control plate as follows:

ZENER CURRENT - Full counterclockwise
 VOLTAGE CALIBRATE - Center of rotation
 METER - ZENER CURRENT

-) Adjust the mechanical zero of the meter with a screwdriver if necessary.
-) Plug the line cord into a standard 117 volt 50/60 cps AC power source. Turn the VOLTAGE RANGE switch to the 5 volt position.
-) Adjust the ZENER CURRENT control for a 5 ma (full scale) reading on the meter.

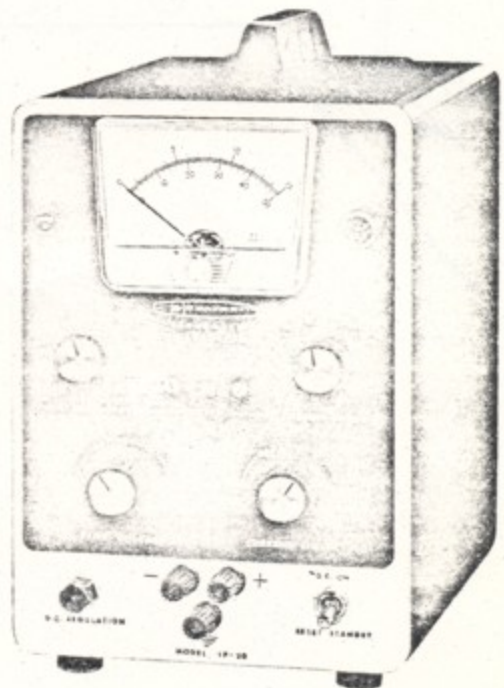

Pictorial 12

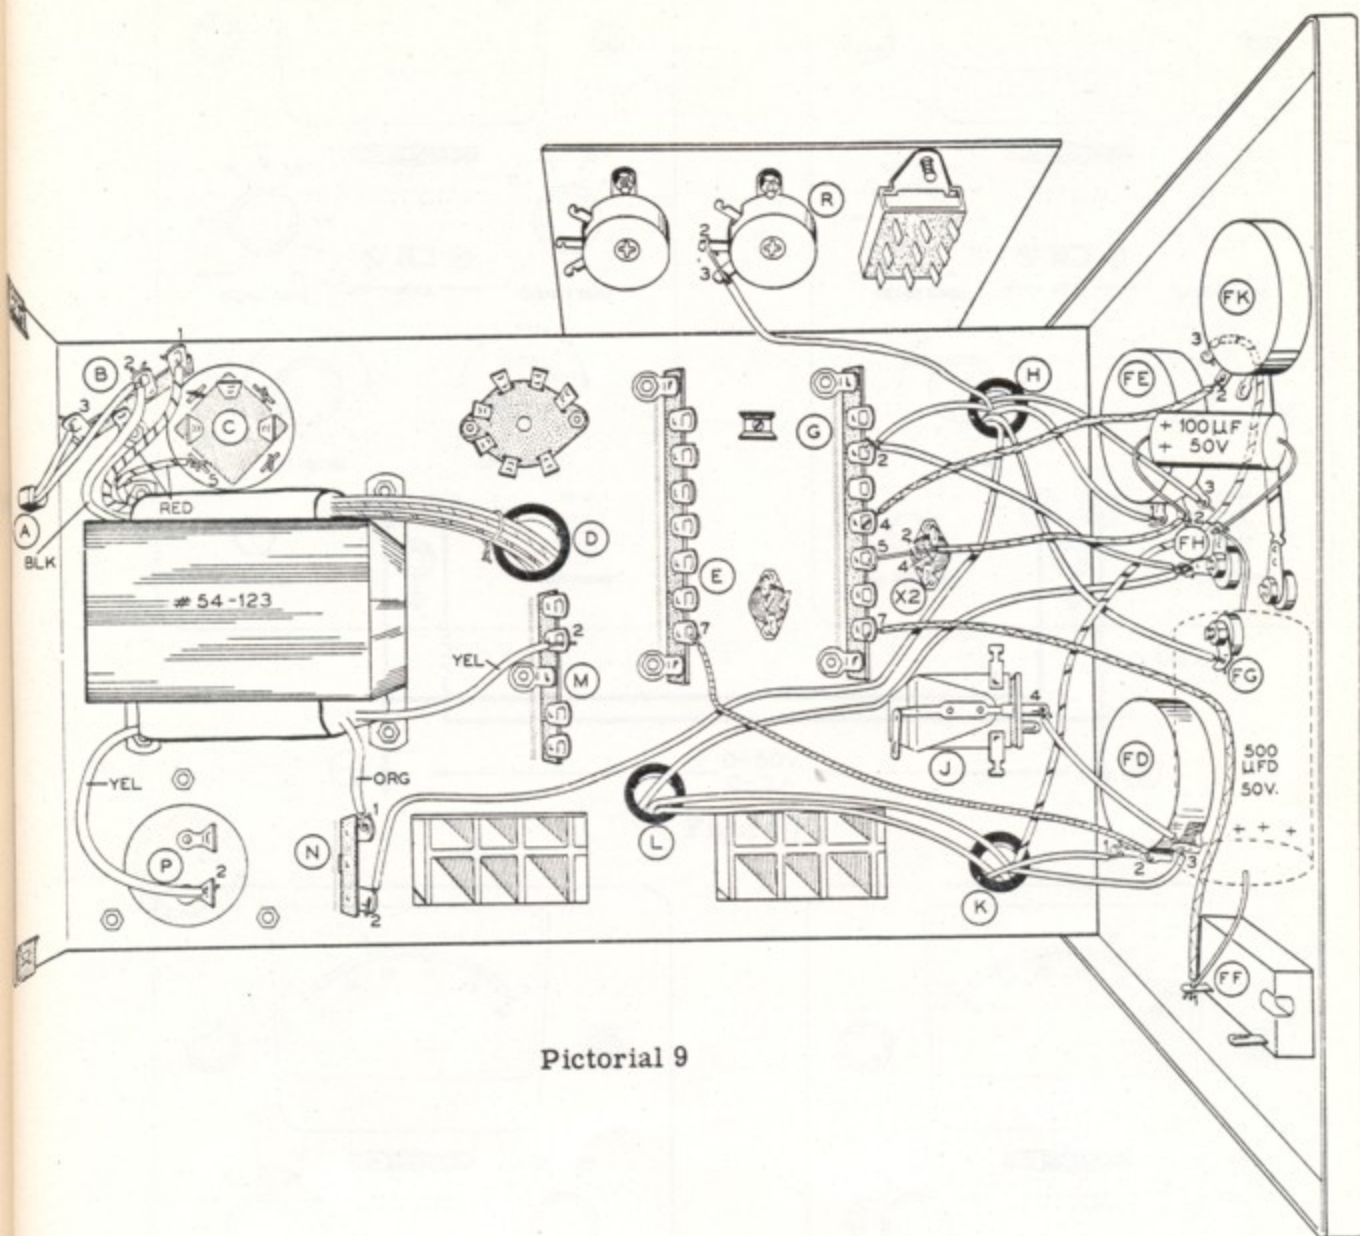

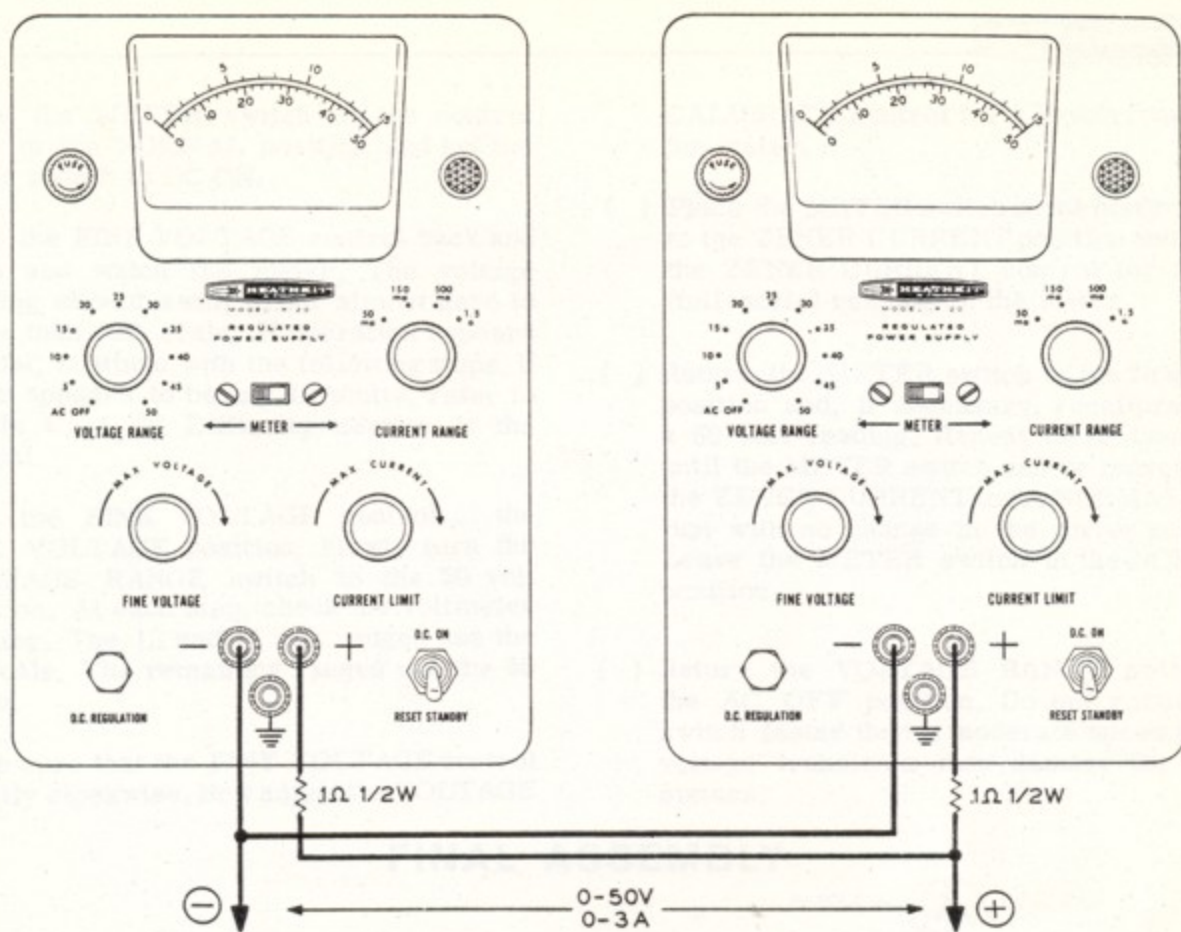


Figure 7

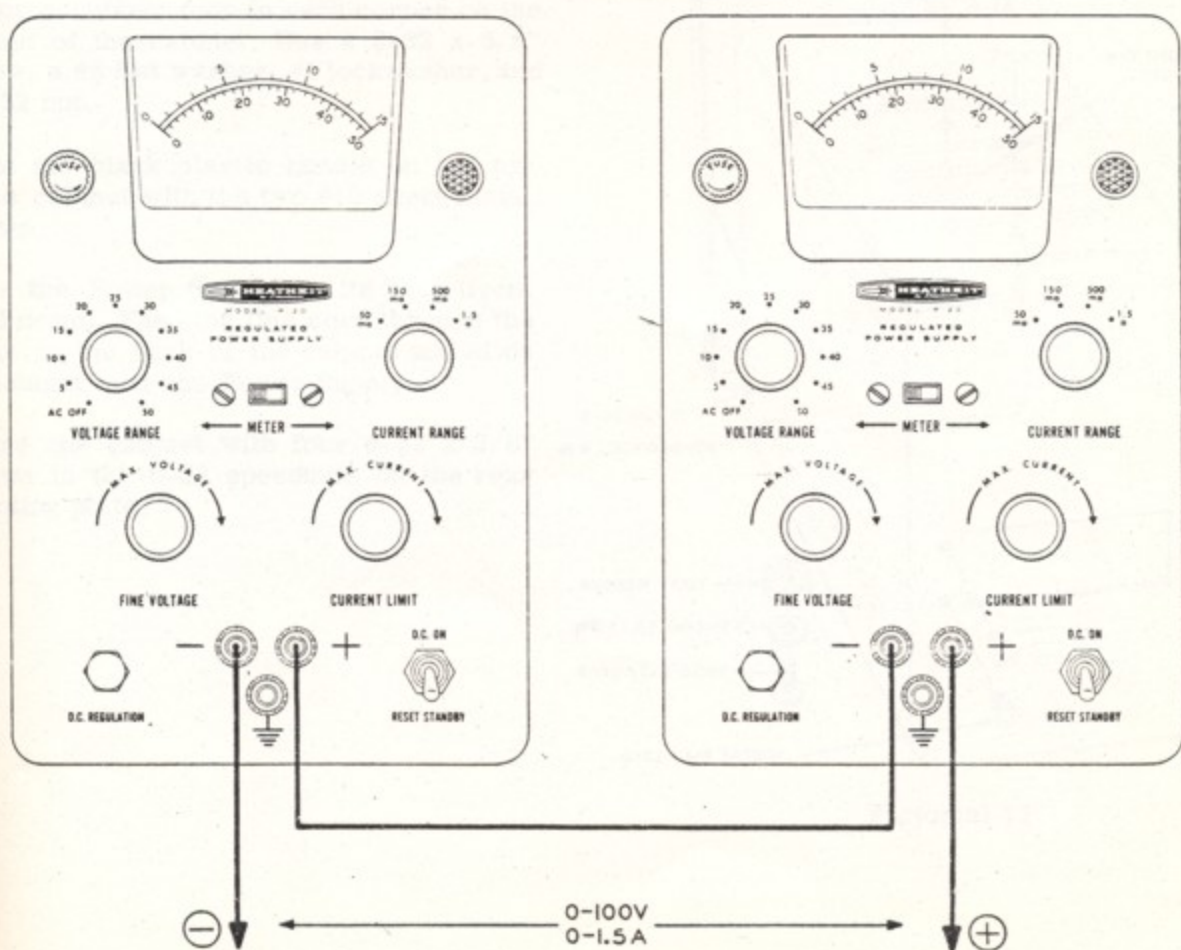


Figure 8

-) Place the METER switch on the control plate in the NORMAL position and set the toggle switch to DC ON.
-) Turn the FINE VOLTAGE control back and forth and watch the meter. The voltage reading should swing from almost zero to more than full scale. If operation appears normal, continue with the following steps. If there appears to be any difficulty, refer to the In Case Of Difficulty section of the manual.
-) With the FINE VOLTAGE control at the MAX VOLTAGE position, slowly turn the VOLTAGE RANGE switch to the 50 volt position. At each step, check the voltmeter reading. The 10 and 15 volt ranges use the 15 scale. The remaining ranges use the 50 scale.
-) Make sure that the FINE VOLTAGE control is fully clockwise. Now adjust the VOLTAGE


CALIBRATE control for a 50 volt reading on the meter.

-) Place the METER switch on the control plate to the ZENER CURRENT position and adjust the ZENER CURRENT control for a 5 ma (full-scale) reading on the meter.
-) Return the METER switch to the NORMAL position and, if necessary, recalibrate for a 50 volt reading. Repeat these two steps until the METER switch can be moved from the ZENER CURRENT to the NORMAL position with no change in the meter reading. Leave the METER switch in the NORMAL position.
-) Return the VOLTAGE RANGE switch to the AC OFF position. Do not rotate this switch faster than a moderate speed as the voltage transients may damage the transistors.

FINAL ASSEMBLY

Refer to Pictorial 13 for the following steps.

-) Mount a rubber foot in each corner on the bottom of the cabinet. Use a 6-32 x 5/8" screw, a #8 flat washer, #6 lockwasher, and a 6-32 nut.
-) Mount the black plastic handle on the top of the cabinet with the two #10 sheet metal screws.
-) Place the Power Supply on its face (front panel down). Feed the line cord through the cutout in the back of the cabinet and slide the cabinet over the Power Supply.
-) Secure the cabinet with four 6-32 x 3/8" screws in the 6-32 speednuts on the rear mounting plate.

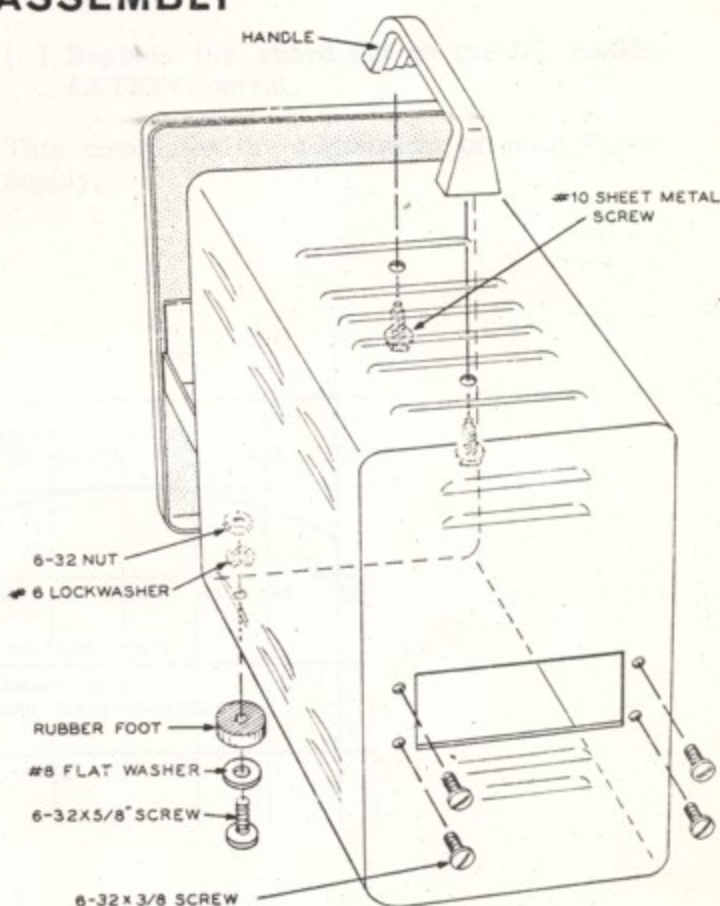

Pictorial 13

NOTE: The blue and white identification label shows the Model Number and Production Series number of your kit. Refer to these numbers in communications with the Heath Company; this assures you that you will receive the most complete and up-to-date information in return.

Install the identification label in the following manner:

1. Select a location for the label where it can easily be seen when needed, but will not show when the unit is in operation. This location might be on the rear panel or the top of the chassis, or on the rear or bottom of the cabinet.
2. Carefully peel away the backing paper. Then press the label into position.

FINAL ADJUSTMENT

NOTE: If a differential voltmeter is available, it may be used for the following adjustment. So, if it is not convenient to do the next five steps, leave the DC REGULATION control as originally set. It will be very close to optimum.

Locate a load that will withstand 1.5 amperes at 15 volts (10 ohms, 22.5 watts).

Turn the VOLTAGE RANGE switch to the 15 volt position and the METER switch in the Voltage position.

Turn the CURRENT RANGE switch to the 1.5 A range and the CURRENT LIMIT control to the maximum clockwise position.

- () Remove the guard nut from the DC REGULATION control.
- () Observe the meter and alternately touch the load across the + and - binding posts and adjust the DC REGULATION control until there is no change in the meter reading as the load is connected and disconnected from the binding posts. This setting will give the regulation characteristic shown in Figure 6.
- () Replace the guard nut on the DC REGULATION control.

This completes the adjustment of your Power Supply.

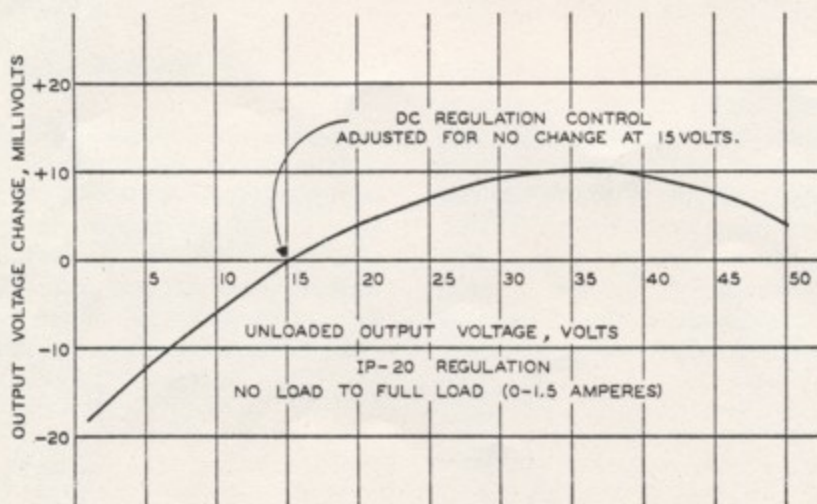


Figure 6

OPERATION

USES

AMMETER USE - When using the Power Supply on the ranges of 50 or 150 ma, there is a 2 ma offset in the meter reading. To correct for this condition, subtract 2 ma from the meter reading. This result will then be the actual current drawn by the load.

CURRENT LIMITER USE - The Power Supply will supply a maximum current (peak plus average current) of 1.5 amperes. This means that the Power Supply will not operate a load that requires 1.5 amperes under "no signal" conditions, as the current limiter circuit in the Power Supply would automatically cut the Power Supply off as the load began drawing more than 1.5 amperes under signal conditions. For example, a transistorized audio amplifier requires 1.0 ampere under no-signal conditions. If a sine wave is applied to the amplifier, the current demand on the Power Supply will also vary in a sine wave fashion. With a 1.0 ampere no-signal level, the current drain can vary .5 ampere without limiting in the Power Supply. However should the signal vary the current demand more than .5 ampere the Power Supply will clip. See Figure 5 on Page 5. This condition can be minimized by connecting a very large capacitor (1000 μ fd or more)

across the output of the Power Supply. The capacitor will discharge into the load during the limiting period and, therefore, reduce the clipping action.

CAUTION: When using the large capacitor, it must be completely discharged before it is connected across the output of the Power Supply. Always start the Power Supply with the VOLTAGE RANGE switch at the lowest range and slowly increase the voltage to the desired level. This will prevent any high current surge that may cause the overload relay in the Power Supply to open.

OVERLOAD RELAY - The relay will open when the output voltage is greater than 7 volts and in the event of a short circuited load, or a load that has become a very low resistance. To reset the relay, push the toggle switch to the RESET STANDBY position. When the load is fixed, return the toggle switch to DC ON.

DC REGULATION CONTROL - On rare occasions, it may be desirable to have no change in output voltage (better than ± 15 millivolts) from no load to full load. In this event simply adjust the DC REGULATION control at the desired output voltage for no voltage change from no load to full load. Return the control to its original setting after this application is completed.

SERIES OPERATION (FIGURE 2)

Two or more Power Supplies can be connected in series for voltages greater than 50 volts. See Figure 2 (fold-out from Page 30). Before a load is connected to the series combination, set the CURRENT RANGE switch and CURRENT LIMIT control the same on each Power Supply. The toggle switch on all but one Supply can be left in the DC ON position. The switch of the Power Supply connected to the (+) side of the load can be used for standby.

CONTROL USE

Place the front panel controls as follows:

VOLTAGE RANGE - AC OFF
 CURRENT RANGE - 1.5A
 CURRENT LIMIT - Full clockwise
 FINE VOLTAGE - Full counterclockwise
 METER - Voltage
 Toggle Switch - RESET STANDBY

Turn the VOLTAGE RANGE switch to the desired range and adjust the FINE VOLTAGE control for the desired voltage as indicated by the meter. CAUTION: Do not rotate the VOLTAGE RANGE switch rapidly as transients will damage the transistors.

Place the METER switch to read Current and place the CURRENT RANGE switch to the desired current range.

Connect the load to the proper binding posts.

Place the toggle switch in the DC ON position.

Rotate the CURRENT LIMIT control counterclockwise until the current reading on the meter starts to decrease, then turn the CURRENT LIMIT control clockwise to just above this point. This adjustment will automatically limit the current output of the Power Supply and thereby protect the load and the Power Supply.

PARALLEL OPERATION (FIGURE 7)

Two or more Power Supplies can be connected in parallel for high current loads. See Figure 7 (fold-out from Page 30). Before connecting the Power Supplies in parallel set the VOLTAGE RANGE, FINE VOLTAGE, CURRENT RANGE, CURRENT LIMIT controls on both Power Supplies so that the output of each Supply is equal to the other. A .1 Ω resistor is also

 
placed in the plus (+) lead of each Power Supply.

- () Place the METER switch in both Power Supplies to read voltage.
- () Connect the two (-) binding posts together.
- () Turn the toggle switch of both Power Supplies to DC ON.
- () Lightly touch the (+) leads (after the .1 Ω resistors) of the two Supplies together. Watch the meter on both Supplies. If the meter reading on one Power Supply increases while the meter reading on the other Power Supply decreases, adjust the FINE VOLTAGE control on either Power Supply until the (+) leads of the Power Supplies can be touched together with no change in meter readings. The (+) leads can now be connected together.
- () The toggle switch on both Power Supplies must be in DC ON position when connected for parallel operation.

Each time a change in control settings is made on one Power Supply, be sure that it is made on the other while the Supplies are not connected together or while the toggle switches are in the reset position.

SERIES OPERATION (FIGURE 8)

Two or more Power Supplies can be connected in series for voltages greater than 50 volts. See Figure 8 (fold-out from Page 30). Before a load is connected to the series combination, set the CURRENT RANGE switch and CURRENT LIMIT control the same on each Power Supply. The toggle switch on all but one Supply can be left in the DC ON position. The switch of the Power Supply connected to the (+) side of the load can be used for standby.



IN CASE OF DIFFICULTY

1. Recheck the wiring. Trace each lead in colored pencil on the Pictorial as it is checked. It is frequently helpful to have a friend check your work. Someone who is not familiar with the unit may notice something consistently overlooked by the constructor.
2. It is interesting to note that about 90% of the kits that are returned for repair, do not function properly due to poor connections and soldering. Therefore, many troubles can be eliminated by reheating all connections to make sure that they are soldered as described in the Proper Soldering Techniques section of this manual.
3. Check the values of the parts. Be sure that the proper part has been wired into the circuit, as shown in the pictorial diagrams and as called out in the wiring instructions.
4. Check for bits of solder, wire ends or other foreign matter which may be lodged in the wiring.
5. If, after careful checks, the trouble is still not located and a voltmeter is available, check voltage readings against those shown on the Schematic Diagram. NOTE: All voltage readings were taken with an 11 megohm input vacuum tube voltmeter. Voltages may vary as much as 10%.
6. A review of the Circuit Description will prove helpful in indicating where to look for trouble.

TROUBLESHOOTING CHART

TROUBLE	CHECK
Pilot lamp will not light.	<ol style="list-style-type: none"> 1. Fuse 2. AC Power switch. 3. OB2 tube. 4. 6S6 lamp.
High output voltage or no response from FINE VOLTAGE control.	<ol style="list-style-type: none"> 1. X4, X5, 2N2147 (short). 2. X3, R265A (short). 3. X2, 2N398A (short).
Low output voltage or no response from FINE VOLTAGE control.	<ol style="list-style-type: none"> 1. X2, 2N398A (short). 2. X1, CQT701A (open). 3. Bias supply for CQT701A. 4. Diodes D1, D2, D3, D4. 5. Transformer. 6. Zener diode, Z1, supply.
High zener current or low zener current.	<ol style="list-style-type: none"> 1. OB2 tube. 2. R47 control (ZENER CURRENT ADJUST). 3. R43 control (VOLTAGE CALIBRATE). 4. Zener diode, Z1.
Loss of current limiting.	<ol style="list-style-type: none"> 1. X1, CQT701A (shorted). 2. Diode D6.
Relay will not operate.	<ol style="list-style-type: none"> 1. Relay. 2. Diode D7.
Power Supply oscillates.	<ol style="list-style-type: none"> 1. Faulty C4. Adding capacity (approximately 100 μfd) in parallel with C4 will usually stop oscillations.

SERVICE INFORMATION

SERVICE

After applying the information in this manual to your best efforts, you are still unable to obtain proper performance, it is suggested that you take advantage of the technical facilities which the Heath Company makes available to its customers.

The Technical Consultation Department is maintained for your benefit. This service is available to you at no charge. Its primary purpose is to provide assistance for those who encounter difficulty in the construction, operation or maintenance of HEATHKIT equipment. It is not intended, and is not equipped to function as a general source of technical information involving modifications nor anything other than the normal and specified performance of HEATHKIT equipment.

Although the Technical Consultants are familiar with all details of this kit, the effectiveness of their advice will depend entirely upon the amount of the accuracy of the information furnished by you. In a sense, YOU MUST QUALIFY for GOOD technical advice by helping the consultants to help you. Please use this outline:

Before writing, fully investigate each of the hints and suggestions listed in this manual under In Case Of Difficulty. Possibly it will not be necessary to write.

When writing, clearly describe the nature of the trouble and mention all associated equipment. Specifically report operating procedures, switch positions, connections to other units, and anything else that might help to isolate the cause of trouble.

 
Report fully on the results obtained when testing the unit initially and when following the suggestions under In Case Of Difficulty. Be as specific as possible and include voltage readings if test equipment is available.

4. Identify the kit Model Number and Series Number, and date of purchase, if available. Also mention the date of the kit assembly manual. (Date at bottom of Page 1.)
5. Print or type your name and address, preferably in two places on the letter.

With the preceding information, the consultant will know exactly what kit you have, what you would like it to do for you and the difficulty you wish to correct. The date of purchase tells him whether or not engineering changes have been made since it was shipped to you. He will know what you have done in an effort to locate the cause of trouble and, thereby, avoid repetitious suggestions. In short, he will devote full time to the problem at hand, and through his familiarity with the kit, plus your accurate report, he will be able to give you a complete and helpful answer. If replacement parts are required, they will be shipped to you, subject to the terms of the Warranty.

The Factory Service facilities are also available to you, in case you are not familiar enough with electronics to provide our consultants with sufficient information on which to base a diagnosis of your difficulty, or in the event that you prefer to have the difficulty corrected in this manner. You may return the completed equipment to the Heath Company for inspection and necessary repairs and adjustments. You will be charged a minimal service fee, plus the price of any additional parts or material required. However, if the completed kit is returned within the Warranty period, parts charges will be governed by the terms of the Warranty. State the date of purchase, if possible.

Local Service by Authorized HEATHKIT Service Centers is also available in some areas and often will be your fastest, most efficient method of obtaining service. HEATHKIT Service Centers will honor the regular 90 day HEATHKIT Parts Warranty on all kits, whether purchased through a dealer or directly from the Heath Company; however, it will be necessary that you verify the purchase date of your kit.



Under the conditions specified in the Warranty, replacement parts are supplied without charge; however, if the Service Center assists you in locating a defective part (or parts) in your kit, or installs a replacement part for you, you may be charged for this service.

HEATHKIT equipment purchased locally and returned to Heath Company for service must be accompanied by your copy of the dated sales receipt from your authorized HEATHKIT dealer in order to be eligible for parts replacement under the terms of the Warranty.

THIS SERVICE POLICY APPLIES ONLY TO COMPLETED EQUIPMENT CONSTRUCTED IN ACCORDANCE WITH THE INSTRUCTIONS AS STATED IN THE MANUAL. Equipment that has been modified in design will not be accepted for repair. If there is evidence of acid core solder or paste fluxes, the equipment will be returned NOT repaired.

For information regarding modification of HEATHKIT equipment for special applications, it is suggested that you refer to any one or more of the many publications that are available on all phases of electronics. They can be obtained at or through your local library, as well as at most electronic equipment stores. Although the Heath Company sincerely welcomes all comments and suggestions, it would be impossible to design, test, evaluate and assume responsibility for proposed circuit changes for special purposes. Therefore, such modifications must be made at the discretion of the kit builder, using information available from sources other than the Heath Company.

REPLACEMENTS

Material supplied with HEATHKIT products has been carefully selected to meet design requirements and ordinarily will fulfill its function without difficulty. Occasionally, improper operation can be traced to a faulty component. Should inspection reveal the necessity for replacement, write to the Heath Company and supply all of the following information.

- A. Thoroughly identify the part in question by using the part number and description found in the manual Parts List.

- B. Identify the kit Model Number and Series Number.
- C. Mention date of purchase.
- D. Describe the nature of defect or reason for requesting replacement.

The Heath Company will promptly supply the necessary replacement. PLEASE DO NOT RETURN THE ORIGINAL COMPONENT UNTIL SPECIFICALLY REQUESTED TO DO SO. Do not dismantle the component in question as this will void the guarantee. This replacement policy does not cover the free replacement of parts that may have been broken or damaged through carelessness on the part of the kit builder.

SHIPPING INSTRUCTIONS

In the event that your instrument must be returned for service, these instructions should be carefully followed.

Wrap the equipment in heavy paper, exercising care to prevent damage. Place the wrapped equipment in a stout carton of such size that at least three inches of shredded paper, excelsior, or other resilient packing material can be placed between all sides of the wrapped equipment and the carton. Close and seal the carton with gummed paper tape, or alternately, tie securely with stout cord. Clearly print the address on the carton as follows:

To: HEATH COMPANY
Benton Harbor, Michigan 49023

ATTACH A LETTER TO THE OUTSIDE OF THE CARTON BEARING YOUR NAME, COMPLETE ADDRESS, DATE OF PURCHASE, AND A BRIEF DESCRIPTION OF THE DIFFICULTY ENCOUNTERED. Also, include your name and return address on the outside of the carton. Preferably affix one or more "Fragile" or "Handle With Care" labels to the carton, or otherwise so mark with a crayon of bright color. Ship by insured parcel post or prepaid express; note that a carrier cannot be held responsible for damage in transit if, in HIS OPINION, the article is inadequately packed for shipment.

WARRANTY

Heath Company warrants that all Heathkit parts shall be free of all defects in materials and workmanship under normal use and service, and in fulfillment of such warranty Heath Company will, for a period of three months from the date of shipment, replace any part upon verification that it is defective.

The foregoing warranty shall apply only to the original buyer, and is and shall be in lieu of all other warranties, whether express or implied and of all other obligations or liabilities on the part of Heath Company and in no event shall Heath Company be liable for any anticipated profits, consequential damages, loss of time or other losses incurred by the buyer in connection with the purchase, assembly or operation of Heathkits or components thereof. No replacement shall be made of parts damaged by the buyer in the course of handling or assembling Heathkit equipment.

The foregoing warranty is completely void if corrosive solder or fluxes have been used in wiring the equipment. Heath Company will not replace or repair any equipment in which corrosive solder or fluxes have been used.



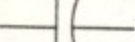
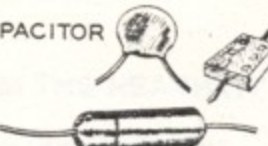
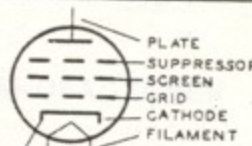

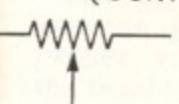
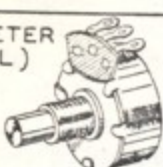
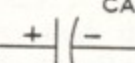
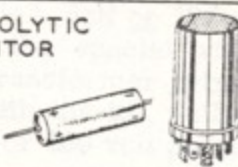
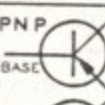
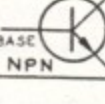













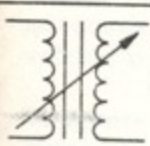


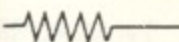


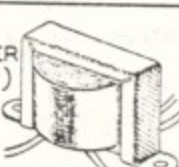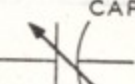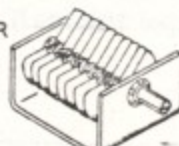

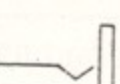



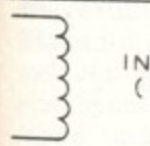
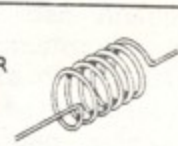

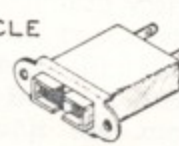
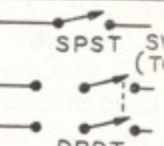
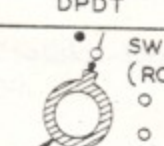
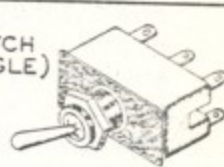
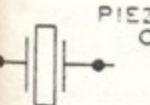

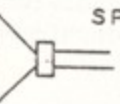

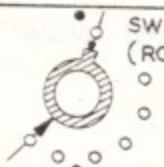

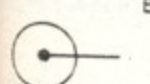
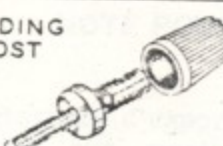
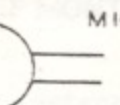
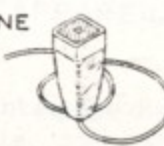
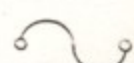


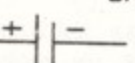
 

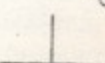
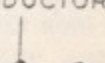
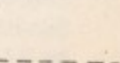
This warranty applies only to Heath equipment sold and shipped within the continental United States including APO and FPO shipments. Warranty replacement for Heathkit equipment outside the United States is on an f.o.b. factory basis. Contact the Heathkit authorized distributor in your country or write: Heath Company, International Division, Benton Harbor, Michigan, U.S.A.

HEATH COMPANY

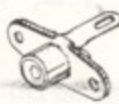TYPICAL COMPONENT TYPES

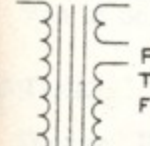This chart is a guide to commonly used types of electronic components. The symbols and related illustrations

should prove helpful in identifying most parts and reading the schematic diagrams.

RESISTOR  	CAPACITOR  	 TUBE PLATE SUPPRESSOR SCREEN GRID CATHODE FILAMENT 
POTENTIOMETER (CONTROL)  	ELECTROLYTIC CAPACITOR  	PNP TRANSISTOR  NPN TRANSISTOR  TRANSISTOR COLLECTOR BASE EMITTER 
TRANSFORMER (IRON CORE)  	VARIABLE CAPACITOR  	RECTIFIER (DIODE)  
TRANSFORMER (ADJUSTABLE POWDERED IRON CORE) ARROW INDICATES DIRECTION OF CORE MOVEMENT TO INCREASE INDUCTANCE  	BATTERY  	 NEON BULB 
TRANSFORMER (ADJUSTABLE CORE)  	PHONO JACK  	 ILLUMINATING BULB 
POWER TRANSFORMER  	 PHONE JACK 	 METER 
INDUCTOR (COIL)  	 RECEPTACLE 	SPST SWITCH (TOGGLE)  DPDT  
PIEZOELECTRIC CRYSTAL  	SPEAKER  	SWITCH (ROTARY)  
BINDING POST  	MICROPHONE  	 FUSE 
ANTENNA GENERAL  LOOP 	 EARTH GROUND  CHASSIS GROUND	CONDUCTORS NOT CONNECTED  CONNECTED  SHIELDED 



HEATH COMPANY

International Division

P.O. BOX 310 — ST. JOSEPH, MICHIGAN 49085
YUKON 3-3961
CABLE: HEATHCO

IMPORTANT ! ... SPECIAL MESSAGE FROM THE HEATHKIT MANUFACTURER

This export model Heathkit is specially equipped with a power transformer to enable you to use your Heathkit from either 115 volt or 230 volt 50/60 cycle power supply. When installing the transformer - follow the special wiring instructions shown on the reverse side of this sheet so that the transformer primary is correctly wired for the proper voltage. The fuses, if supplied with the kit, will provide adequate protection to the transformer primary for either 115 volt or 230 volt power line applications.

Ask your dealer (or write us) about other Heathkit export model equipment available as kits or assembled.

See other side.

IMPORTANTE ! ... ANUNCIO ESPECIAL DEL FABRICANTE HEATHKIT

El modelo para exportación Heathkit está especialmente equipado con un transformador de fuerza para permitirle usar su Heathkit en corriente de 115 voltios o 230 voltios 50/60 ciclos. Al instalar su transformador, siga las instrucciones de alambrado mostradas al dorso para que el transformador suministrado con el kit, le de protección adecuada al lado primario del transformador para aplicaciones en corriente de 115 voltios o 230 voltios.

Pregunte a su vendedor (o escribanos) acerca de otros modelos Heathkit para exportación disponibles como kits (desarmados) o armados.

Vea al dorso.

WICHTUNG ! ... WICHTIGE MITTEILUNG DES HEATHKIT-HERSTELLERS

Dieser Heathkit-Bausatz, Export-Modell ist speziell mit einem Netz-Transformator ausgerüstet, der den Anschluss an 115 volt oder 230 volt, 50/60 Hz, ermöglicht. Beim Einbau dieses Transformators beachten Sie bitte die besonderen Verdrahtungsanweisungen auf der Rückseite dieses Blattes, damit der richtige Primäranschluss für die gewünschte Netzspannung gewährleistet ist. Sofern diesem Bausatz Sicherungen beiliegen, gewähren diese ausreichenden Schutz sowohl bei 115 volt als auch bei 230 volt Netzanschluss.

Fragen Sie Ihren Händler (oder schreiben Sie uns) nach weiteren Heathkit-Export-Modellen, die als Bausätze oder als fertig verdrahtete Geräte erhältlich sind.

Siehe umseitig.

IMPORTANT ! ... NOTE POUR LES MONTEURS D'APPAREILS HEATHKIT

Cet appareil Heathkit d'exportation est spécialement équipé d'un transformateur d'alimentation permettant son emploi soit sur 115 volts, soit sur 230 volts 50/60 Hz. Lorsque l'on met en place le transformateur, suivre les instructions spéciales de câblage décrites au verso de façon à câbler correctement le primaire. Les fusibles, s'ils sont fournis avec l'appareil, protégeront efficacement le primaire du transformateur sur 115 et 230 volts.

Demandez à votre vendeur (ou écrivez-nous) pour tous les modèles Heathkit d'exportation disponibles en "kits" ou montés.


Voir au verso.

ATTENZIONE ! . . . MESSAGGIO SPECIALE DAL MANIFATTORE DI HEATHKIT


Il Heathkit modelo "E" per l'estero, è specialmente fornito con un trasformatore con cui potrete adoperare il vostro Heathkit sia con corrente di 115 volt o 230 volt, 50/60 Hz. Quando pronti a installare il trasformatore sequire le istruzioni qua giù, così che sarete sicuri che il trasformatore fornito in questa scatola di montaggio darà adeguata protezione al primario del trasformatore quando adoperato sia per 115 volt o 230 volt.

Chiedete al vostro agente o scrivete a noi, se c'è un altro modelo Heathkit che vi interessa sia in scatola da montaggio o già adunati.

WIRING DIAGRAM FOR HEATHKIT POWER TRANSFORMER

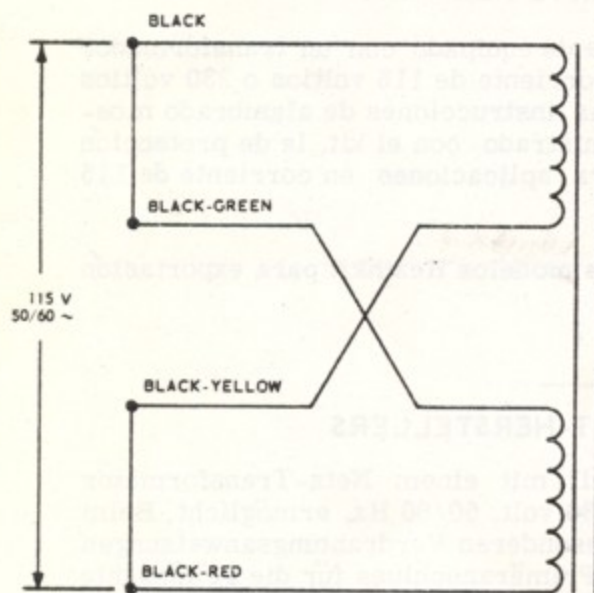

FOR 115 V 50/60 ~
PRIMARIES - PARALLEL

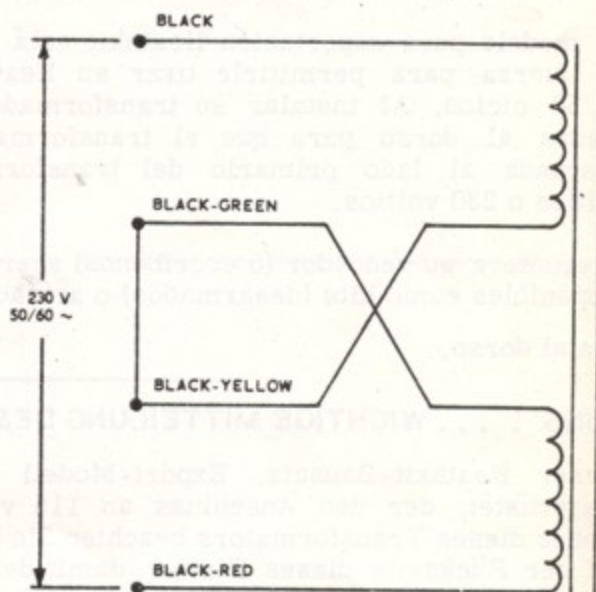

FOR 230 V 50/60 ~
PRIMARIES - SERIES

	Italian	French	German	Spanish
Black:	Nero	Noir	Schwarz	Negro
Black-Green:	Nero-Verde	Noir-Vert	Schwarz-Grün	Negro-Verde
Black-Yellow:	Nero-Giallo	Noir-Jaune	Schwarz-Gelb	Negro-Amarillo
Black-Red:	Nero-Rosso	Noir-Rouge	Schwarz-Rot	Negro-Rojo